

MIL "ON" DTC P3190, P3191 and/or P0A0F

Service Category Engine/Hybrid System

Section Engine Control

Market USA

Toyota Supports ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2010 – 2011	Prius	

REVISION NOTICE

May 10, 2012 Rev1:

- Introduction and Repair Procedure sections have been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2010 – 2011 model year Prius vehicles may exhibit a MIL "ON" condition with Diagnostic Trouble Code(s) (DTCs) P3190 (Poor Engine Power), P3191 (Engine Does Not Start), P0A0F (Engine Failed to Start), and/or purge VSV/PCV line separation from the throttle body housing. The Engine Control Module/ECM (SAE term: Powertrain Control Module/PCM) logic has been revised to address this condition.

Warranty Information

OP CODE	DESCRIPTION	TIME	MODEL YEAR	OFF	T1	T2
EG1110	Recalibrate ECM (PCM) Engine	0.4	2010	89660-47300 89660-47301	87	99
			2011	89660-47430		

APPLICABLE WARRANTY

- This repair is covered under the Toyota Federal Emission Warranty. This warranty is in effect for 96 months or 80,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

MIL "ON" DTC P3190, P3191 and/or P0A0F

Calibration Information

MODEL YEAR	PREVIOUS CALIBRATION ID	NEW CALIBRATION ID	VDS
2010	34715000	<u>34715300</u>	KN3DU
	34715100		
	34715200		
2011	34728000	<u>34728100</u>	

Parts Information

MODEL YEAR	PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
2010	89660-47300	89660-47302	Computer, Engine Control (ECM/PCM)	-
	89660-47301			-
2011	89660-47430	89660-47431		-
-	00451-00001-LBL	Same	Authorized Modification Labels	1

NOTE

- The ECM (PCM) should NOT be replaced as part of the repair procedure.
- Authorized Modification Labels may be ordered in packages of 25 from the Materials Distribution Center (MDC) through Dealer Daily – Dealer Support Materials Orders.

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
TIS Techstream* or Techstream Lite NOTE: Software version 7.10.030 or later is required.	ADE	TSPKG1 or TSLITEDLR01	1

NOTE

- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.
- The Diagnostic Tester is NOT recommended for flash reprogramming with this calibration file. Please use TIS Techstream or an approved J2534 interface to perform this update. Visit techinfo.toyota.com for more information regarding J2534 reprogramming.



MIL "ON" DTC P3190, P3191 and/or P0A0F

Required Tools & Equipment (Continued)

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
GR8 Battery Diagnostic Station*	00002-MCGR8	1

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

* Essential SST.

Repair Procedure

1. Inspect for proper installation of the PCV hose and Purge VSV vacuum line at the throttle body. Ensure the vacuum line is secured at the Purge VSV.


If all lines are properly seated, this bulletin does NOT apply. Follow normal diagnostic procedures per the Repair Manual.

Reinstall and secure any unseated lines, then proceed to step 2.
2. Check for the Authorized Modifications Label affixed to the vehicle in the location shown in Figure 1. Confirm if the ECM (PCM) calibration has been updated. If the calibration ID listed is NOT the latest ECM (PCM) calibration — go to step 3.

MIL "ON" DTC P3190, P3191 and/or P0A0F

Repair Procedure (Continued)

Figure 1. Location of Authorized Modifications Label on 2010 and 2011 Prius

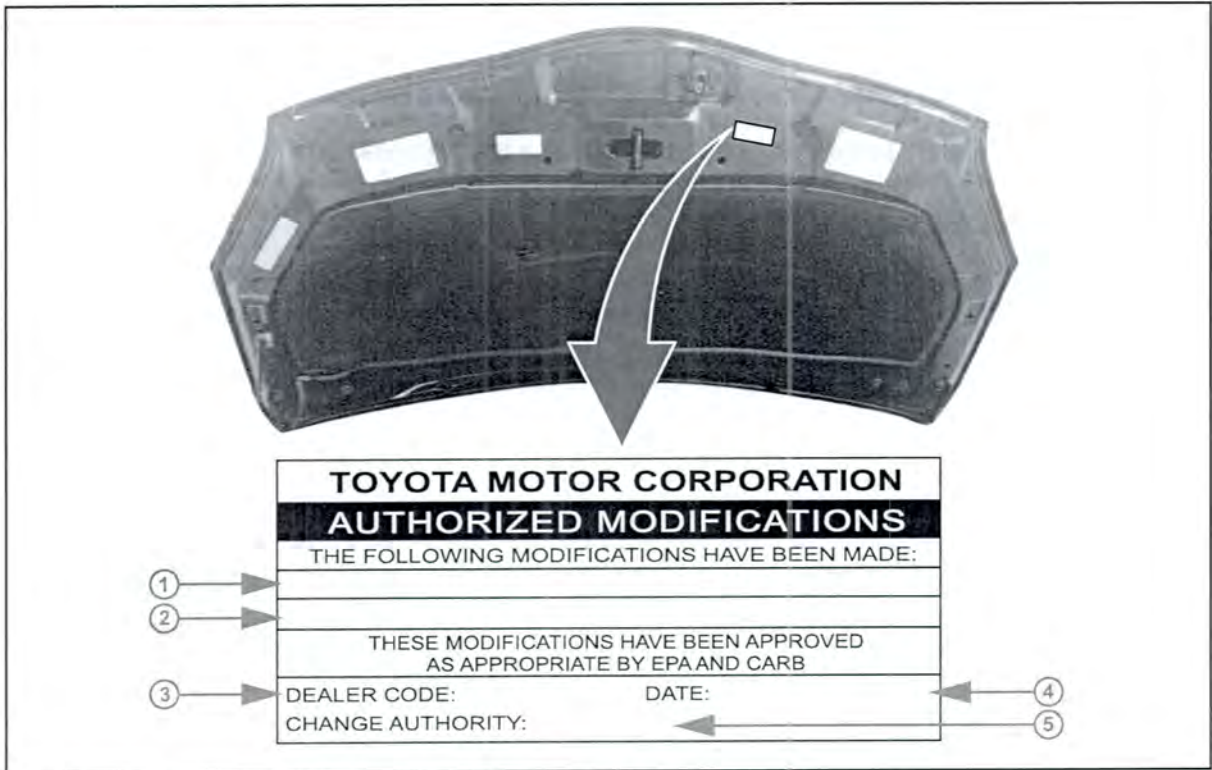

1	Replacement ECM (PCM) Part Number (i.e., 89660-47302)
2	New Calibration ID(s) (i.e., 34715300)
3	Dealer Code

4	Date Completed
5	This SB Number

3. Flash reprogram the ECM (PCM).

NOTE

- The GR8 Battery Diagnostic Station **MUST** be used in Power Supply Mode to maintain battery voltage at 13.5 volts while flash reprogramming the vehicle.
- For details on how to use the GR8 Battery Diagnostic Station, refer to the [GR8 Instruction Manual](#) located on the Technical Information System (TIS), *Diagnostics – Tools & Equipment – Battery Diagnostics*.

Follow the procedures outlined in Service Bulletin [T-SB-0064-10](#), "Techstream ECU Flash Reprogramming Procedure", and flash the ECM (PCM) with the NEW calibration file update.

MIL "ON" DTC P3190, P3191 and/or P0A0F

Repair Procedure (Continued)

4. Install the Authorized Modifications Label.
 - A. Using a permanent marker, enter the following information on the label:
 - ECM part number [*Refer to the **Parts Information** section for the **CURRENT PART NUMBER***]
 - Calibration ID(s) [*Refer to the **Calibration Identification Chart** for the **NEW CALIBRATION ID***]
 - Dealer Code
 - Repair Date
 - Change Authority [***This SB** number*]
 - B. Affix the Authorized Modifications Label to the vehicle at the location shown in Figure 1. The Authorized Modifications Label is available through the MDC, P/N 00451-00001-LBL.
5. Test drive the vehicle to confirm proper vehicle operation.