Technical Bulletin



SERVICE BULLETIN					
Classification:	Reference:	Date:			
AT15-015a	NTB15-086a	November 11, 2015			

2013-2015 ALTIMA AND 2014-2016 ROGUE; MIL ON WITH DTC P0776

The Parts Information and the Claims Information in this bulletin have been amended.

Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2013-2015 Altima (L33) with 4-cyl engine only

2014-2016 Rogue (T32)

NOTE: Does not apply to Rogue Select (S35)

IF YOU CONFIRM:

The MIL is ON and ONLY DTC P0776 (PC SOLENOID B – Pressure Control Solenoid "B" Performance/Stuck OFF) is stored in the TCM.

NOTE: If this issue should occur, the vehicle may he sitate and/or have a lack of power.

ACTION:

Refer to the **Repair Flow Chart** on page 2.


NOTE: Essential Tool Tech Cam (borescope) J-51951, which is used for CVT inspection, has been sent to dealers. This tool's attachements make CVT inspection possible.

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You MUST closely follow the <u>entire</u> **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely.

NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

Repair Flow Chart

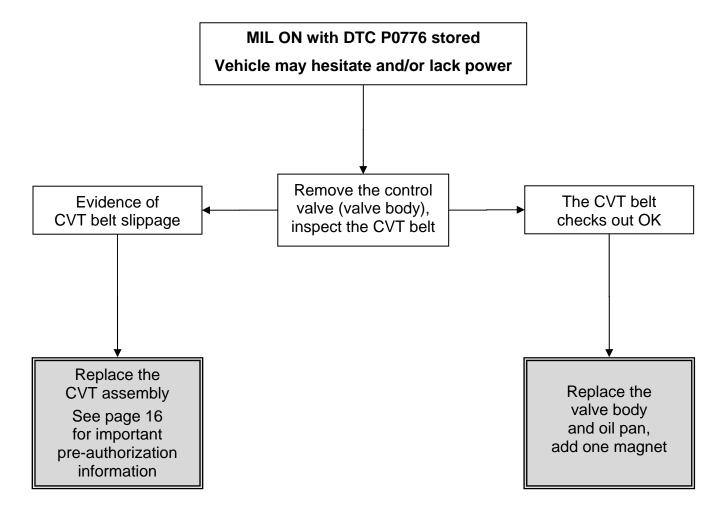

SERVICE PROCEDURE

Exploded View

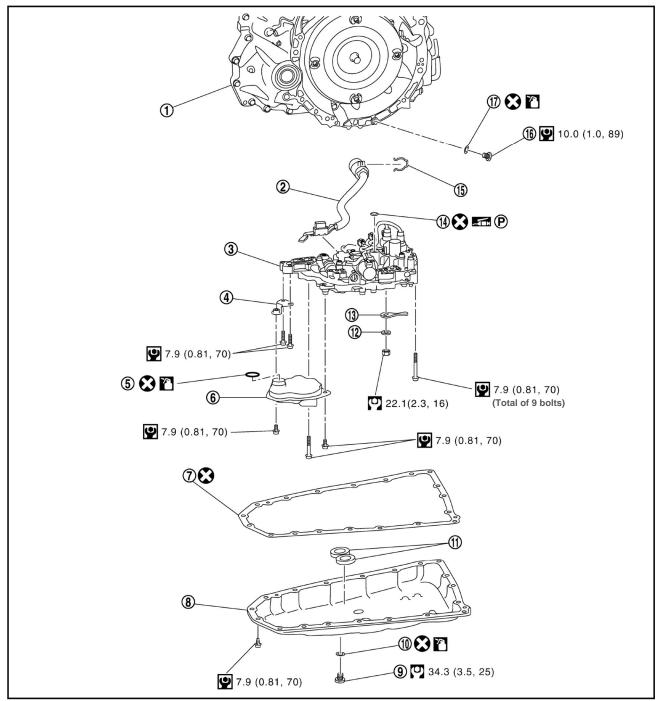


Figure 1

- Transaxle (CVT) assembly
- Bracket
- Oil pan gasket
- Drain plug gasket
- Manual plate
- Overflow plug

- Terminal cord assembly
- O-ring
- Oil pan
- Two original magnets
- (14) Lip seal
- O-ring

- 3 Control valve (valve body)
- Oil strainer assembly
- O Drain plug
- Spring washer
- 15 Snap ring

Control Valve (Valve Body) Removal and CVT Belt Inspection

- 1. Remove the valve body.
 - Before lifting the vehicle:
 - Place the transmission gear selector in Neutral.
 - > Leave the driver door unlatched. A step further in the procedure may require it.
 - For Altima: Refer to the appropriate ESM, section TM Transaxle & Transmission, for valve body removal.
 - For Rogue: Refer to the 2013 Altima ESM, section TM Transaxle & Transmission / RE0F10D, for valve body removal.

NOTE: The number '7' is on the head of all bolts that need to be removed for valve body removal. Do not remove any bolt that does not have the number '7'.

CAUTION: Never allow any chemicals or fluids other than NS-3 CVT fluid or equivalent to enter the CVT assembly. Never allow any foreign debris, dust, dirt, etc. to enter the CVT assembly.

• For additional information, see video # 544: "CVT Belt Inspection". This video is located under the TECH TRAINING GARAGE VIDEOS tab in Virtual Academy.

- 2. Secure the front <u>right</u> tire with a suitable strap.
 - This will assist in making the belt turn.
- 3. Mark the front <u>left</u> tire with a suitable marking.
 - This will assure all 360° of the belt is inspected.



Figure 2

Using borescope J-51951 with mirror attachment, inspect the entirety of the two sides of the belt that come in contact with the pulleys (see page 7, Figure 8).
 Reference the pictures on pages 7 thourgh 11 for comparison.

NOTE:

- Be sure to remove the protective film from the mirror before the first use.
- Clean the camera lens and mirror before each inspection. Use 90% isopropyl alcohol, and a lens swab from Lens Swab packet J-51963 listed in PARTS INFORMATION.
- Before inspecting, make sure the camera handle's AA batteries are fresh and the LCD monitor's battery is charged.
- a. Insert the camera lens between the CVT case and pulley where shown in Figures 3 and 4.
 - Insert the lens approximately seven
 (7) inches, and then view the side of the belt that contacts the pulley.

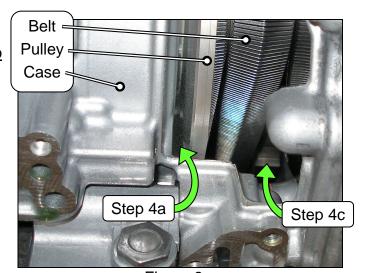


Figure 3

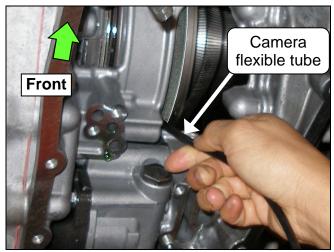


Figure 4

- b. Slowly and carefully turn the front left tire one full turn in the forward rotation to view all of the belt.
 - Holding the borescope with one hand allows for turning the tire with the other hand (see Figure 5).

CAUTION: If the tire is rotated in the rearward rotation, the camera lens may get caught between the belt and pulley.

- c. If the inspection result is OK, inspect the other side of the belt.
 - Insert the camera lens in the second location where shown in Figure 3 and 6, and then perform step 4b again.
- d. If the inspection result is OK 360° on both sides of the belt, skip to step 5 on the next page.
 - If any evidence of belt slippage is found, go to step 4e, and then step 6.
 - For additional information, see video # 544: "CVT Belt Inspection". This video is located under the TECH TRAINING GARAGE VIDEOS tab in Virtual Academy.



Figure 5

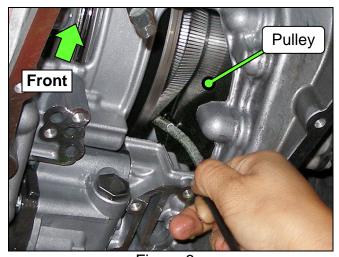


Figure 6

e. Once CVT replacement is determined as required, use borescope J-51951 to record a 15 second or less continuous video of the most severe evidence of belt slip and the VIN on the F.M.V.S.S. certification label (VIN label). See Figure 7.

NOTE: This required video must be attached to the Powertrain Call Center CVT Preauthorization Form (in ASIST) prior to calling for authorization. Failure to submit a continuous video will cause immediate denial of request for replacement.



Figure 7

- Before starting to record, make sure the camera handle's AA batteries are fresh and the LCD monitor's battery is charged.
- The whole video will show as backward, or reversed mirror image. This is okay.
- The required video must show clear evidence of belt slippage and be 15 seconds or less.
- 5. If the belt inspection result is OK, replace the valve body.
 - There is no need for pictures or video showing "OK" belt surfaces.
 - For valve body replacement, go to page 12, Control Valve (Valve Body) Installation.
- 6. If the belt inspection result is NG, replace the CVT assembly.
 - Get authorization to replace the CVT assembly (see page 16).
 - Make sure to perform step 4e on page 6.
 - For CVT assembly replacement, refer to the appropriate ESM, section **TM Transaxle & Transmission / RE0F10D**.

IMPORTANT: Perform "ADDITIONAL SERVICE WHEN REPLACING TRANSAXLE ASSEMBLY".

- Refer to TM Transaxle & Transmission / RE0F10D / BASIC INSPECTION:
 - Check for fluid leakage.
 - Install Write IP Characteristics to the TCM.
- The CVT unit requiring replacement will need to be reassembled for Nissan parts return/collection.
- 7. Flush the CVT cooler(s).

IMPORTANT: A CVT Cooler flush is required after a valve body or CVT assembly replacement. Refer to bulletin NTB15-013 to perform CVT Cooler flush.




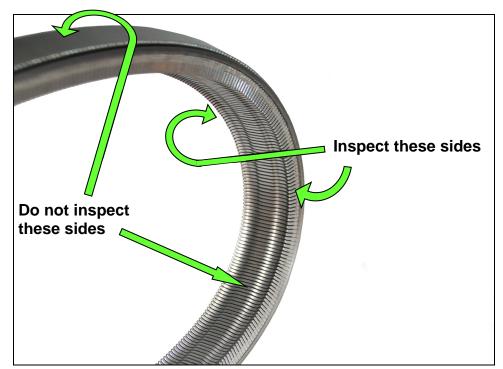


Figure 8

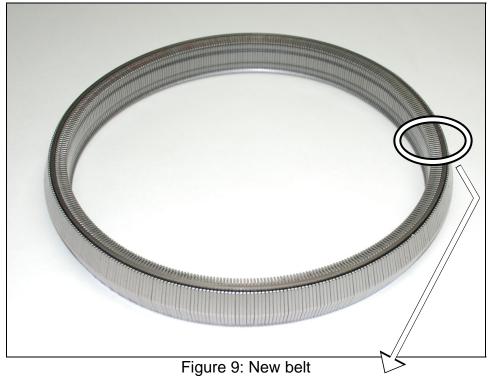

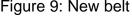

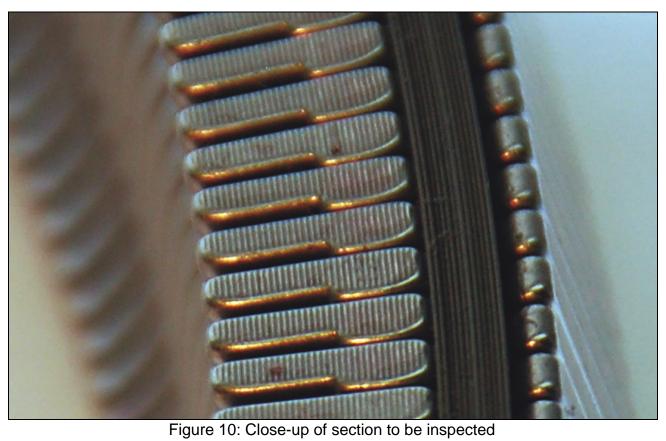

Pictures in Figures 11 and 12 were taken with borescope J-51951.

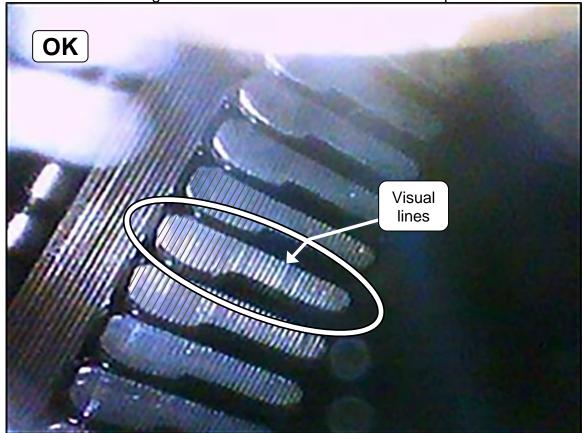


Figure 11: Belt is OK

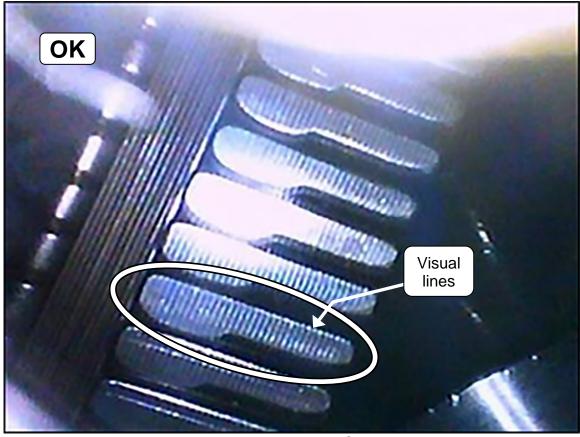


Figure 12: Belt is OK

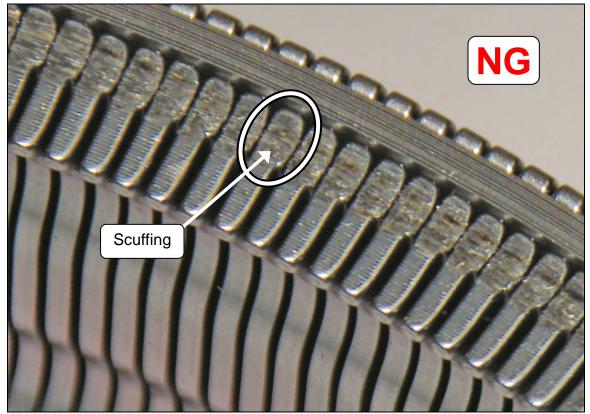


Figure 13: Example of NG belt

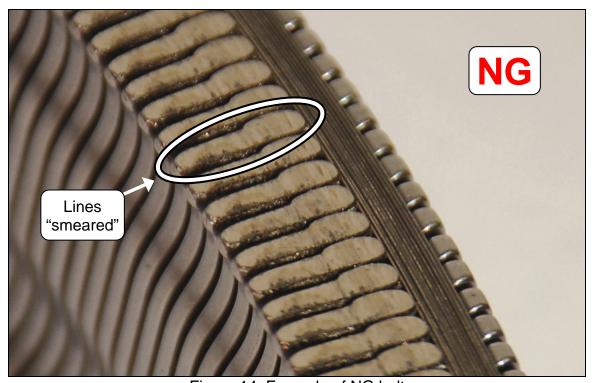


Figure 14: Example of NG belt

Pictures in Figures 15-17 were taken with borescope J-51951.



Figure 15: Example of NG belt



Figure 16: Example of NG belt



Figure 17: Example of NG belt

Control Valve (Valve Body) Installation

- 1. Install the valve body.
 - For Altima: Refer to the appropriate ESM, section **TM Transaxle & Transmission**, for valve body installation.
 - For Rogue: Refer to the 2013 Altima ESM, section TM Transaxle & Transmission / RE0F10D, for valve body installation.

NOTE: Make sure the oil strainer and O-ring are replaced.

CAUTION: Never allow any chemicals or fluids other than NS-3 CVT fluid or equivalent to enter the CVT assembly. Never allow any foreign debris, dust, dirt, etc. to enter the CVT assembly.

- 2. Install a <u>new style oil pan</u> with the addition of a third magnet.
 - Additional magnet is listed in the PARTS INFORMATION.
 - Refer to the ESM, section **TM-Transaxle & Transmission**, for oil pan installation.

CAUTION: Never allow any chemicals or fluids other than NS-3 CVT fluid or equivalent to enter the CVT assembly. Never allow any foreign debris, dust, dirt, etc. to enter the CVT assembly.

- Install the one additional magnet and two existing magnets where shown in Figure 18.
- Make sure the new oil pan and magnets are thoroughly clean before installing.

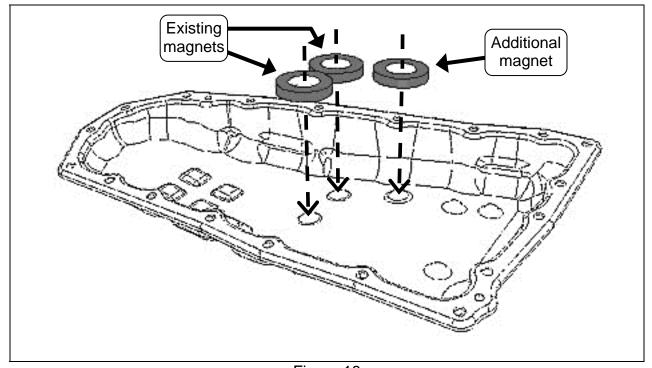


Figure 18

- 3. Fill the CVT assembly with NS-3 CVT fluid or equivalent.
 - Refer to the ESM, section TM Transaxle & Transmission / RE0F10D, for CVT fluid filling.
- 4. **IMPORTANT:** Install Write IP Characteristics to the TCM.
 - Refer to TM Transaxle & Transmission / RE0F10D / BASIC INSPECTION, and perform ADDITIONAL SERVICE WHEN REPLACING TRANSAXLE ASSEMBLY.
 - Check for fluid leakage.
 - Attach the QR label with the new calibration data onto the transmission range switch (inhibitor switch).
 - See Figure 19 and 20 below.
 - o A QR Label and CD-R are included with the replacement valve body.

5. Erase the DTC.

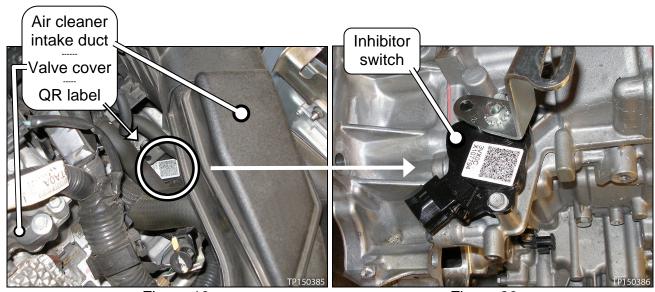



Figure 19 Figure 20

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY	
CVT ASSEMBLY (1)	(2)	1	
VALVE ASSEMBLY-CONTROL (valve body) (3)	31705-28X0B	1	
STRAINER ASSEMBLY - OIL	31728-1XZ0D	1	
PAN ASSY-OIL	31390-3VX0C	1	
GASKET-OIL PAN	31397-1XF0D	1	
SEAL-LIP	31528-1XZ0A	1	
MAGNET	31379-3AX0A	1	
WASHER-DRAIN	11026-JA00A	1	
SEAL, O-RING (fluid filler plug gasket)	31526-3VX0B	1	
NS-3 CVT Fluid (4) (5)	999MP-NS300P	As needed	
Lens Swab (6) (7)	J-51963	As needed	

- (1) If the CVT assembly is being replaced, no other parts in the table above, except NS-3 CVT fluid or equivalent, are needed.
- (2) Refer to the electronic parts catalog (FAST or equivalent) for the correct part number.
- (3) Includes QR Label, CD-R, and Control Valve Assembly.
- (4) For warranty repairs, Nissan NS-3 CVT Fluid <u>must</u> be used. For customer pay repairs, Nissan NS-3 CVT Fluid or an equivalent is recommended.
- (5) NS-3 CVT Fluid can be ordered through the Nissan Maintenance Advantage program: Phone: 877-NIS-NMA1 (877-647-6621) or Website: Order via link on dealer portal www.NNAnet.com and click on the "Maintenance Advantage" link.
- (6) Lens swabs are available from Tech•Mate online: www.nissantechmate.com, or by phone: 1-800-662-2001.
- (7) Shop supply.

Tech Cam J-51951

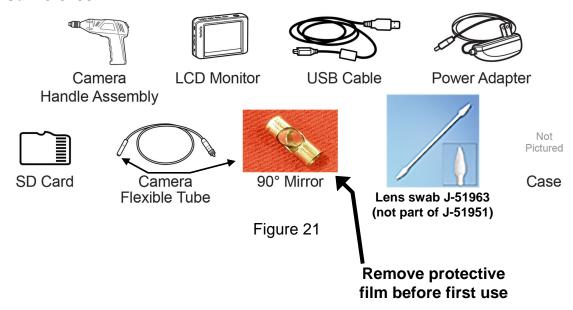

Additional kits of Tech Cam J-51951 are available from Tech•Mate online: www.nissantechmate.com, or by phone: 1-800-662-2001.

CLAIMS INFORMATION

NOTE: Refer to **CVT Assembly Replacement Approval Procedures** (on the next page) before submitting a claim.

If belt condition shows no signs of belt slip, OK

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL CVT CONTROL VALVE ASSY	(1)	JD48AA	ZE	32	(2)

- (1) Reference the Parts Information Table and use the applicable Control Valve Assembly Part Number (31705-*****) as the Primary Failed Part.
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time.

NOTE: FRT allows adequate time to access DTC codes. No other diagnostic procedures subsequently required. Do NOT claim any diagnostic OP Codes with this claim.

And

DESCRIPTION	OP CODE	FRT
Inspect CVT Belt, Belt = OK	JX37AA	0.3

OR

If belt inspection shows signs of belt slip, NG

MODEL	DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Altima	CVT R&R		JD01AA	ZE	32	(4)
Rogue		(3)	JD023A			
Altima/ Rogue	CVT TROUBLE DIAGNOSIS		JX22AA			0.5

- (3) Reference the electronic Parts Catalog (FAST or equivalent) and use the CVT assembly part number for the vehicle being repaired as the Primary Failed Part.
- (4) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time.

NOTE: FRT allows adequate time to access DTC codes. No other diagnostic procedures subsequently required. Do NOT claim any diagnostic OP Codes with this claim.

And

DESCRIPTION	OP CODE	FRT
Inspect CVT Belt, Belt = NG (Includes control valve R&I)	JX36AA	2.2

CVT Assembly Replacement Approval Procedures

- > If CVT belt inspection indicates CVT assembly replacement is required:
 - a. Complete the PCC CVT Preauthorization Form in ASIST.
 - b. Attach the required video (15 seconds or less) to the CVT Preauthorization Form.
 - Failure to submit a continuous video showing evidence of belt slip and the VIN will cause immediate denial of request for CVT unit replacement.
 - c. Call the PCC for authorization at 800-973-9992 (opt 2).

IMPORTANT: Make sure the video has a clear image of the VIN on the F.M.V.S.S. certification label (VIN label).