



GROUP  
Climate Control

MODEL  
2014MY  
Soul (PS)

NUMBER  
PS300


DATE  
May 2014



## TECHNICAL OPERATIONS

**SUBJECT:** INCORRECTLY ROUTED HIGH PRESSURE A/C LINE

When addressing a customer concern related to the A/C system not cooling the vehicle properly and/or a case with low refrigerant; check the routing for the A/C high pressure line to make sure it is not coming into contact with the accessory drive belt (see image). If the line has come into contact with the belt and has sustained damage, replace the line and recharge the system to resolve the concern.

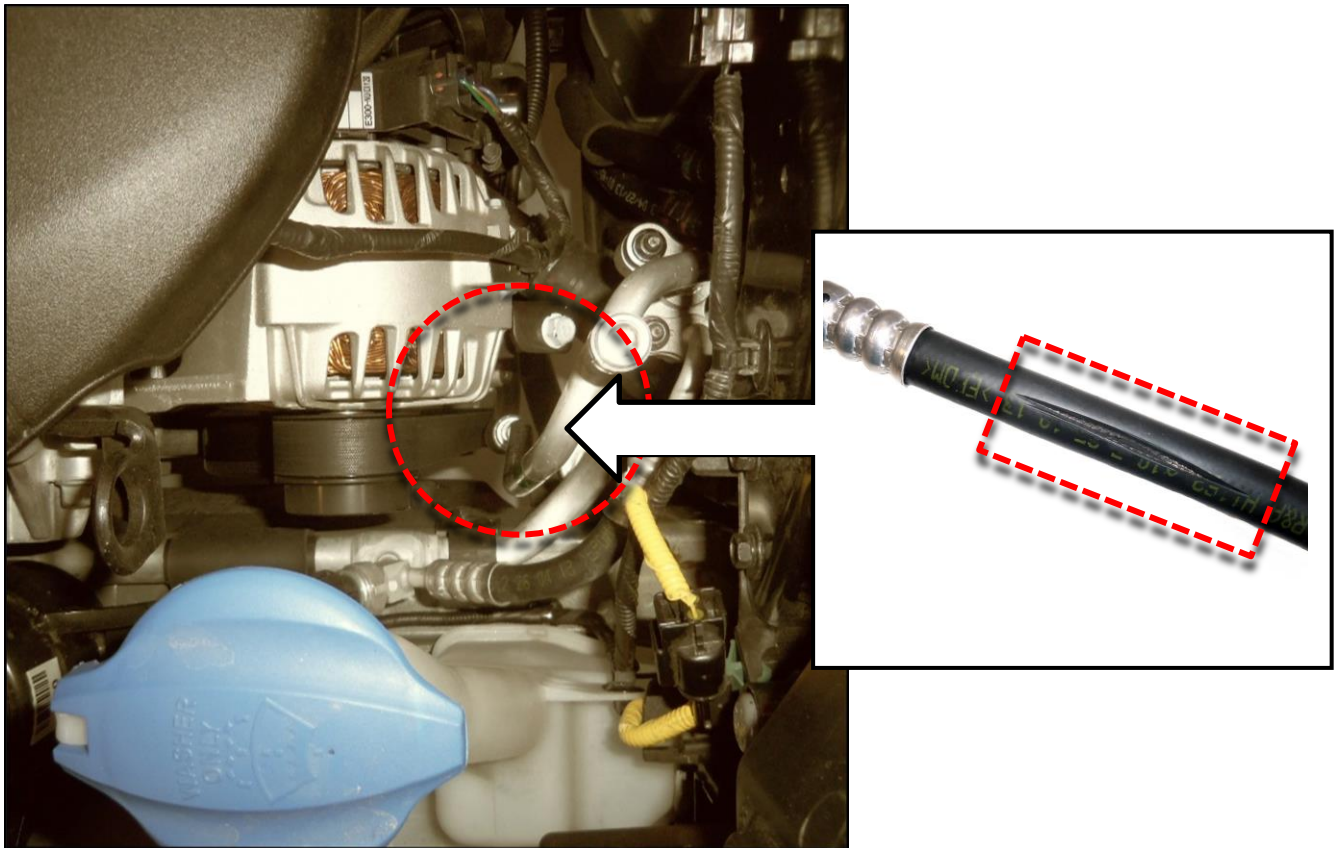

**Countermeasure Date: February 7, 2014**