

Subject

Touch Screen Inoperative with Display Audio

Market

USA

Service Category

Audio/Visual/Telematics

Section

Audio/Video

Applicability

All Applicable Models

APPLICABLE VEHICLES


2014	xD	2014-2015	FR-S
2014-2015	xB	2014-2015	tC
2014-2015	iQ		

CONDITION

Some vehicles equipped with Display Audio may exhibit a condition where the touch screen is inoperative.

RECOMMENDATIONS

This condition may be caused by foreign object or debris stuck between the display audio screen and the faceplate. If you see any foreign object or debris (refer to the pictures below), please use paper/card with thickness less than 0.1mm (e.g. business card) to remove it.

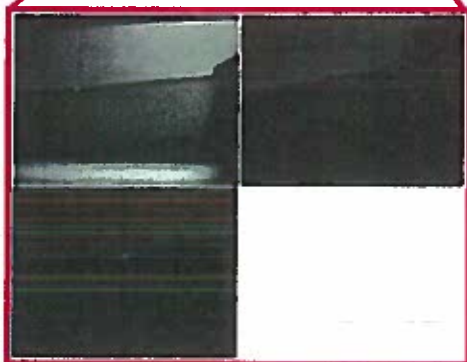

Note:

- Radio screen/button layout can be different by model.
- Do not blow air onto the faceplate to remove the debris, compressed air sprayed on the display can cause moisture inside the radio assembly.

LINK REFERENCES

This Tech Tip does not contain any link references