

This Service Program replaces SP 365-001 (USA139200206) dated 7.17

Service Program Trucks

 Date
 Group
 No.
 Release
 Page

 7.2017
 365 001 02 1(3)

Vehicle ECU, Reprogramming VN

SP 365-001, Vehicle ECU, Reprogramming

(July 2017)

On Certain Volvo Trucks with the AMTF transmission, using transmission PTO1, there could be grinding when engaging PTO or PTO will not remain engaged when shifting from "drive or reverse" to "neutral". This is due to a VECU SW issue. To correct this issue follow the procedure below:


Volvo Trucks North America	Date	Group	No.	Release	Page
Service Program	7.2017	365	001	02	2(3)

Vehicle ECU, Reprogramming Procedure

You must read and understand the precautions and guidelines in Service Information, group 30, "General Safety Practices, Electrical" before performing this procedure. If you are not properly trained and certified in this procedure, ask your supervisor for training before you perform it.

NOTE: Information is subject to change without notice. Illustrations are used for reference only and can differ slightly from the actual vehicle being serviced. However, key components addressed in this information are represented as accurately as possible.

- 1 Park the vehicle on a flat and level surface.
- 2 Apply the parking brake.
- 3 Place the transmission in neutral or park.
- 4 Install the wheel chocks.

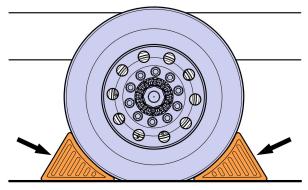


W7086748

- 5 Using Premium Tech Tool (PTT), connect to the vehicle.
- 6 Run Accessory kit 85151972.
- 7 Reprogram the VECU, MID144.

Note: Follow the on screen prompts until the programming is complete.

- 8 Disconnect the vehicle from Premium Tech Tool (PTT).
- 9 Remove the wheel chocks.

Volvo Trucks North America	Date	Group	No.	Release	Page
Service Program	7.2017	365	001	02	3(3)

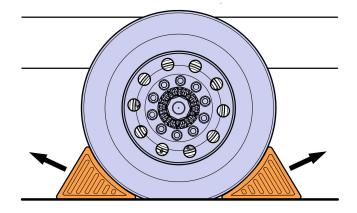

W7086759

Reimbursement

This repair is covered by an authorized Service Program. Reimbursement is obtained via the normal claim handling process.	UCHP Reimbursement	
Claim Type (used only when uploading from the Dealer Bus. Sys.)	В	
Recall Status		
Vehicle inspected, repair not required		
Vehicle repaired per instruction		
Labor Code		
Primary Labor Code (Vehicle ECU, Reprogramming)	3651-22-09-02 0.3 hrs	
Take to take charge and determine campaign status	1700–16–01–01 0.3 hrs	
Causal Part	22592366	
SCC Code	S7188	
Authorization Number	NA	
Expiration Date	July 31, 2018	