

This Field Service bulletin replaces bulletin FSB 258-036 dated 3.2015.

Date 3.2015 Group **258** No. **036** Release **02** Page 1(5)

DEF Sensor Assembly Routing
 VAH, VHD, VN

FSB 258-036, DEF Sensor Assembly Routing

(March 2015)

Information


New routing and clipping changes have been implemented for all vehicles assembled after January 5, 2015 in regards to the DEF module harness. The new harness is much stiffer which requires re-routing to avoid cable stress. This also applies to any previously built vehicles when the DEF sensor assembly is replaced.

DEF Sensor Assemblies

Part Number	DEF Tank Capacity	Engine
22306793	25L	Volvo
22306791	33L	
22306787	45L	
22306785	70L	
22306813	25L	Cummins
22306818	70L	


Service personnel: Please circulate, read and initial

Service Manager	Warranty Administrator	Workshop Foreman	Service Technicians						

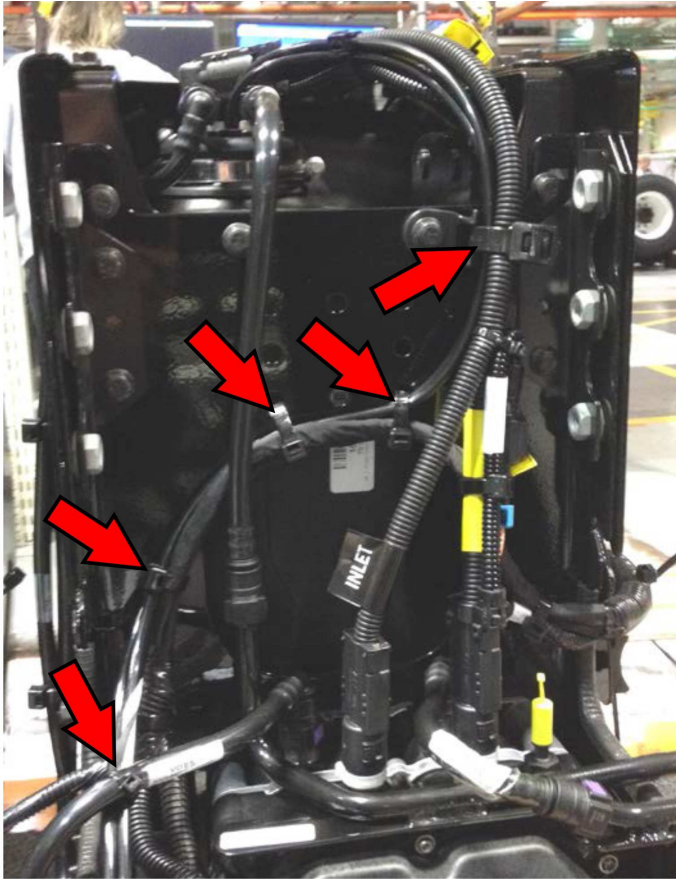


W2099961

Route and tie the harness as shown

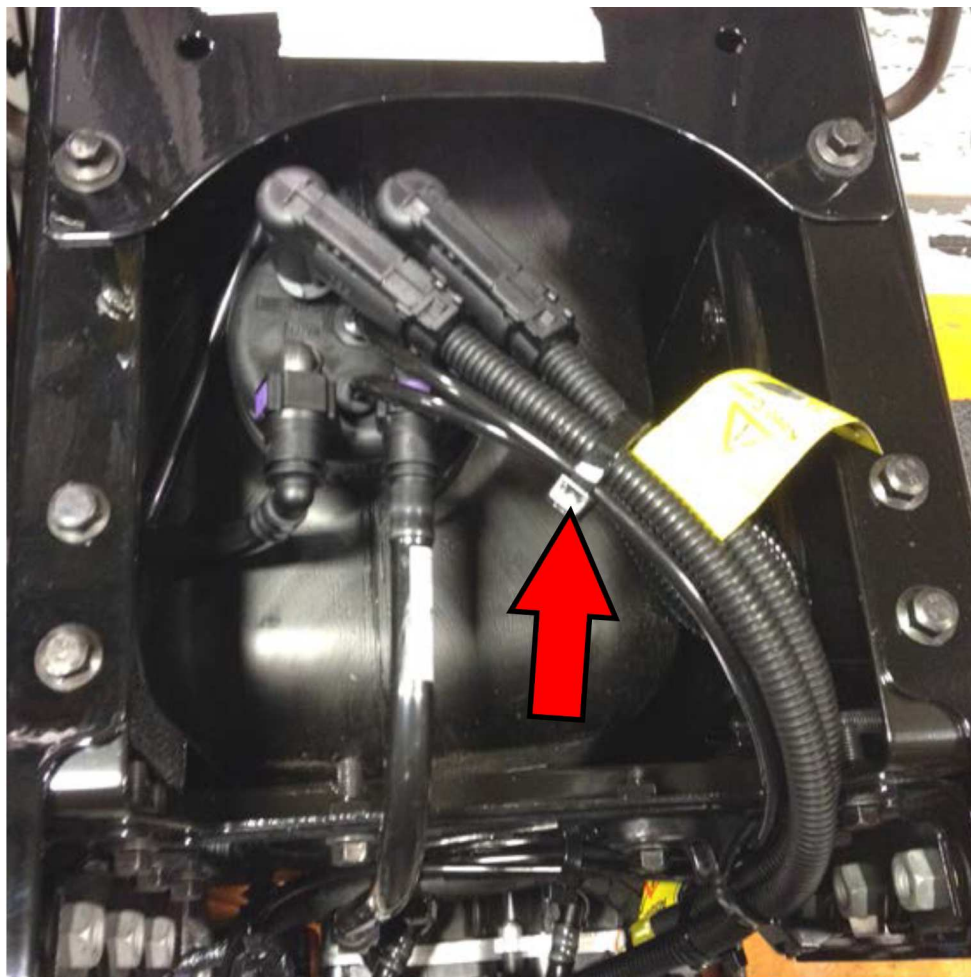


W2099959

Route and tie the harness as shown

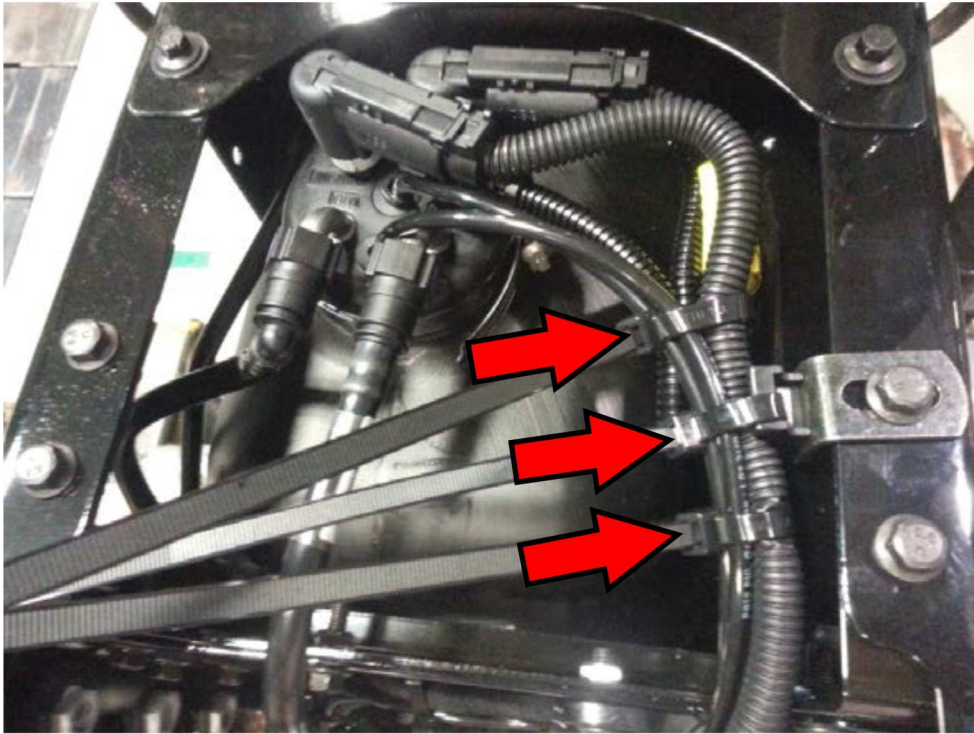

W2099960

| Daycab Routing

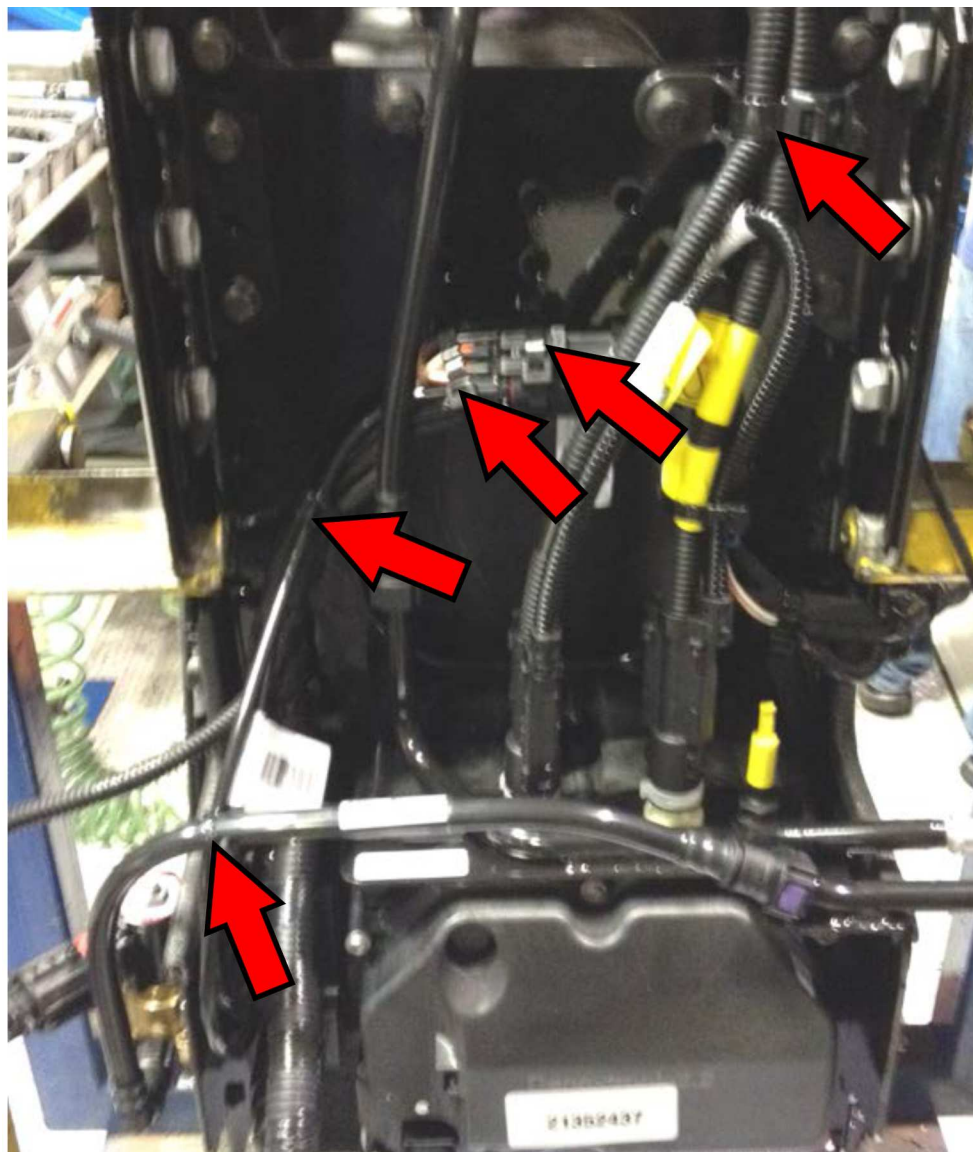

W2099962

VNL with Cummins ISX Routing