

Classification:

Reference:

 COPYRIGHT© NISSAN NORTH AMERICA, INC.
 Date:

EC18-010a

ITB18-014a

May 8, 2018

2019 QX50; MIL ON WITH "CODE_200400" OR "CODE_001200" STORED

This bulletin has been amended throughout. Discard all previous versions of this bulletin.

APPLIED VEHICLES: 2019 QX50 (J55)

SERVICE INFORMATION

If the MIL is ON and CONSULT-III plus (C-III plus) shows "CODE_200400" or "CODE_001200" (Figure 1) stored under **ENGINE**, perform Electronic Service Manual (ESM) diagnostics for DTC P2004 (SWIRL CONT/V (B1)) or P0012 (INTAKE VALVE TIMING CONTROL), respectively.

- C-III plus will be updated/corrected at a later date.

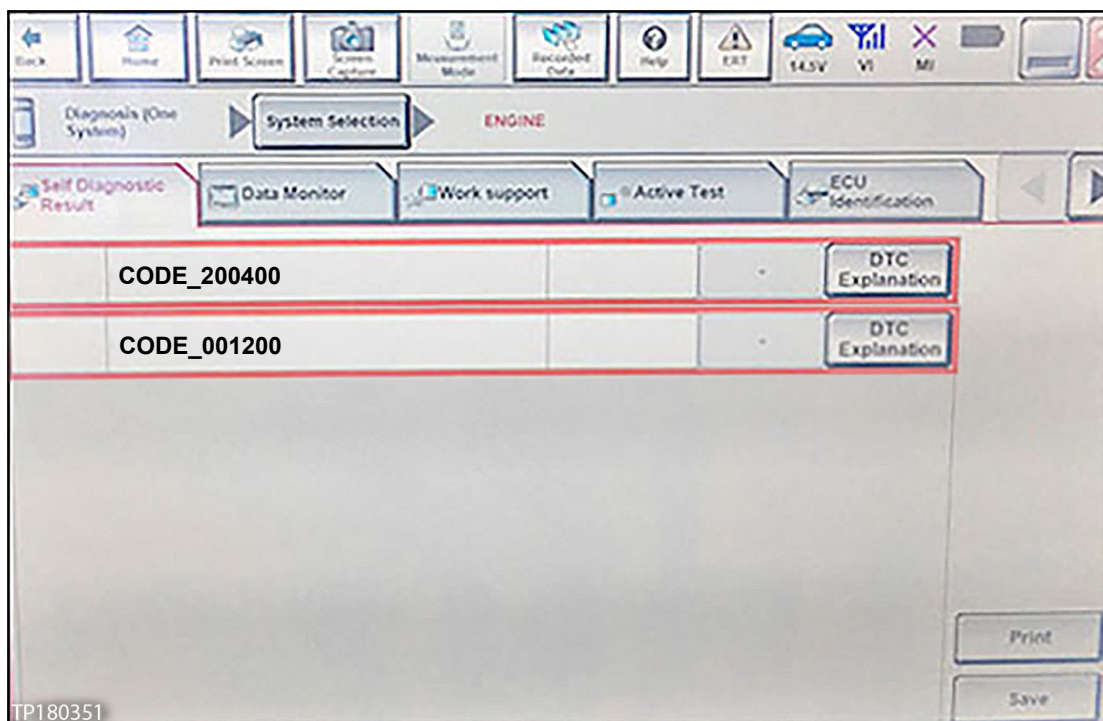


Figure 1

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.