



Bulletin No.: PIP5558B

Published date: N/A

## Preliminary Information

### PIP5558B Clutch Pedal Stays On The Floor - Pedal Does Not Return To Top Of Travel Or Pedal Returns Slowly

Product Investigation Review Required

#### Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Cruze	2016 - 2018	Gen II VIN B	Current	All	MF3 MZ4 MZ0 M60

Involved Region or Country:	North America, South America, GMIO, China, Korea, Australia/NZ
Condition:	<b>Clutch Pedal stays on the floor, pedal does not return to top of travel or pedal returns slowly.</b>
Cause:	<b>Debris in orifice</b>

#### **Correction:**

Item number 1 in the picture below has a small orifice internally that fluid passes through. If small pieces of debris in the fluid get pushed to or through the orifice then it will restrict oil flow. The debris may restrict the orifice then the pedal return will be affected. Customer may notice any of the following concern: Pedal stays on the floor, pedal does not return to top of travel or pedal returns slowly.

Engineering is currently investigating and a bulletin will be published when a repair is validated.

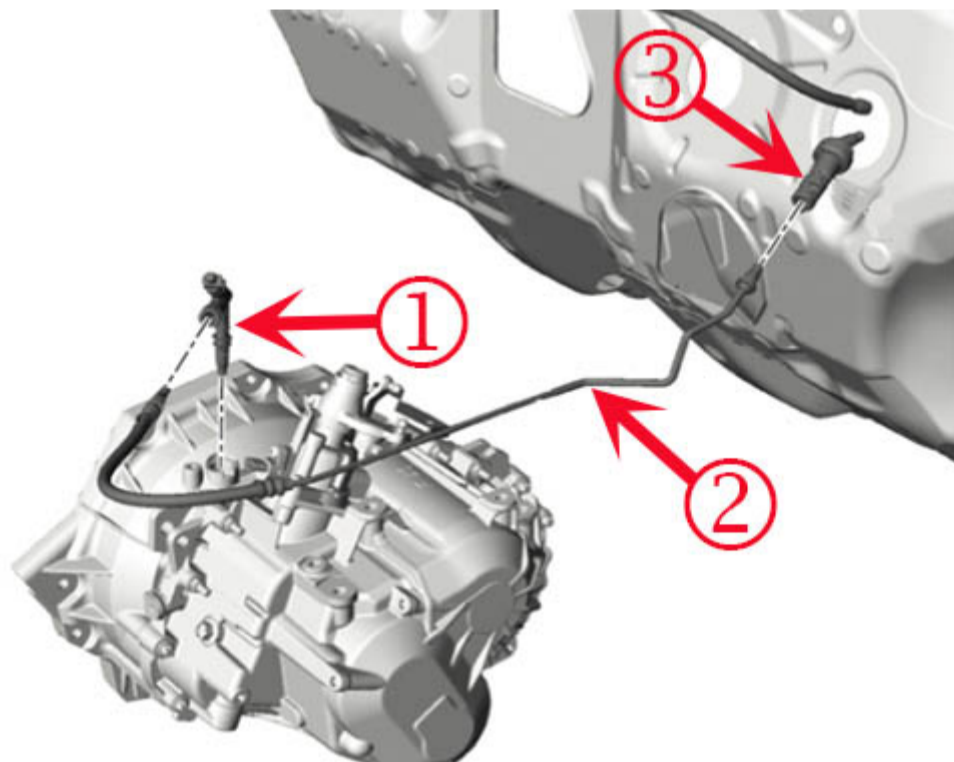

#### Version History

Version	3
Modified	Created on 02/27/2018 3/6/18 - Added regions and remove build date. 6/6/18- Removed repair instructions.



GENERAL MOTORS

© 2018 General Motors. All Rights Reserved.