



## CROSS TRAFFIC WARNING MISSING FROM INTEGRATED OWNERS MANUAL

### MODEL


G30 (5 Series Sedan)

Vehicles from Start of Production to July 1 2017 equipped with option codes:

- ZDT Drive Assistance Plus
- 5AT Camera

### SITUATION

The crossing traffic warning (right of way warning) section is missing from the integral owner's manual (IBA). The picture below shows the missing text.

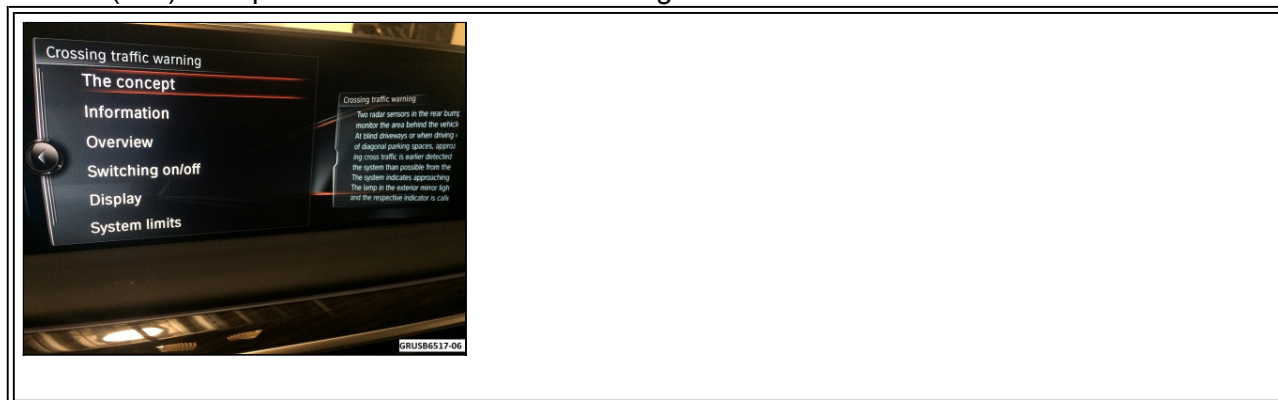

### CAUSE

Software error in the Head unit IBA file

### CORRECTION

Reprogram and encode the vehicle with ISTA/P 3.62 or ISTA 4.06.01

### PROCEDURE

Program the vehicle using ISTA/P 3.62.0 or ISTA 4.06.01 or higher (these versions are expected to release Mid-June 2017).



Note: Until these SW versions release, please explain to the customer that the cross traffic description is available in the paper version of the owner's manual and also in the online

operating instructions.

Note that ISTA/P and ISTA will automatically reprogram and code all programmable control modules that do not have the latest software.

**Always connect a BMW approved battery charger/power supply ([SI B04 23 10](#)).**

For information on programming and coding with ISTA/P, refer to CenterNet / TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

## PARTS INFORMATION

Parts exchange will not correct the situation.

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>6512580200</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Main work)
Or:		
00 00 556	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Plus work)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply (indicated in KSD 2 as Charging battery)
And:		
61 00 730	Refer to KSD2	Programming/encoding control unit(s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

### Vehicle Programming and Coding

When ISTA/P automatically reprograms and codes all the vehicle's control modules that "currently do not have" the latest software and if one or more control module failures occur "during" this

programming procedure:

- Please claim this “consequential” control module-related repair work under the defect code listed in this bulletin with the applicable KSD2/AIR labor operations.

### **Other Repairs**

Control module failures that occurred “prior” to performing this programming procedure:

- When “covered” under an applicable limited warranty, claim this control module-related repair work using the applicable defect code and labor operations in KSD2/AIR.

[ Copyright ©2017 BMW of North America, Inc. ]