

Classification:  
 EL17-011b

 Reference:  
 ITB17-029b

 Date:  
 January 16, 2019

## 2017 QX30; PUSH-BUTTON IGNITION SWITCH MID-YEAR CHANGE

This bulletin has been amended. See AMENDMENT HISTORY on the last page.  
Please discard previous versions of this bulletin.

**APPLIED VEHICLES:**                    2017 QX30 (H15)

### SERVICE INFORMATION

A mid-year change has been made to the ignition system in the Applied Vehicles.

Vehicles produced on November 3, 2016 and after (see VIN information on page 2) are equipped with a push-button ignition switch instead of a turning ignition switch.

**NOTE:** See Figures 1 and 2 on page 2 to view images of both ignition switches.

In addition, vehicles equipped with the push-button ignition switch include the following features:

- All doors automatically unlock when the ignition is turned OFF
- All doors automatically lock when the vehicle speed reaches 15 MPH
- Windows open/close when holding down Intelligent Key unlock/lock button
- Emergency engine shut off by rapidly pushing ignition switch three (3) times

Model Year	Turning Ignition	Push-button Ignition	Auto Door Unlock when Ignition Turned OFF	Auto Door Lock at 15 MPH	Window Open/Close using I-Key	Emergency Engine Shut Off – Push Ignition 3X
2017	•					
2017.5		•	•	•	•	•

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.

Vehicles built **BEFORE**  
VIN: SJK(\*)H5C(\*\*)HA 029900

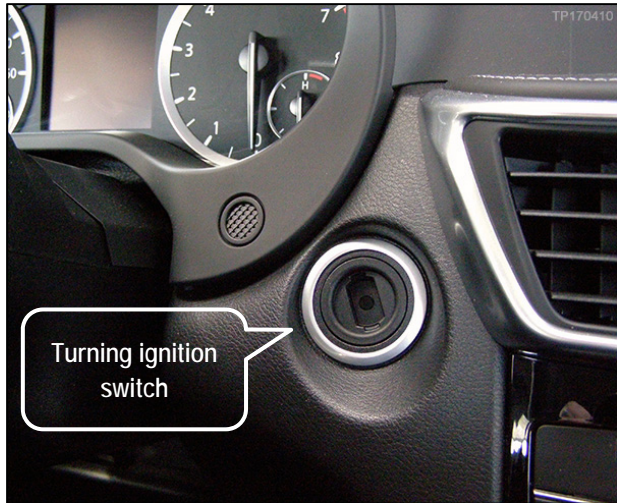


Figure 1

Vehicles built **AFTER**  
VIN: SJK(\*)H5C(\*\*)HA 029899

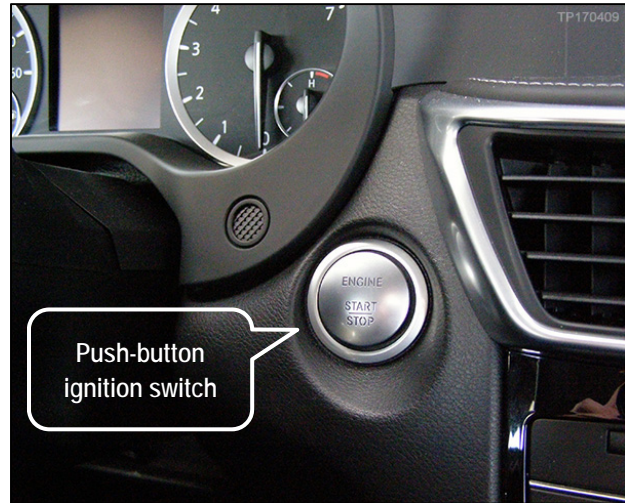


Figure 2

**WARNING:**

- Do NOT retrofit the push-button ignition switch to vehicles produced before the application date. Please reference Infiniti Parts and Service Bulletin IPSB/16-422.
- Modifications to the ignition switch are unauthorized, and may violate Federal law by making inoperative a device installed in compliance with Federal safety standards.
- Damage or failure due to changes or modifications to the ignition switch system are not covered under the terms of the warranty.
- Damage or failure due to changes or modifications to the ignition switch system are not subject to indemnification under the terms of the Infiniti Dealer Sales and Service Agreement.
- Retailers may be obligated under their Sales and Service Agreement to indemnify Infiniti for any damages, injuries, or deaths caused by modification of the ignition switch system.

**AMENDMENT HISTORY**

PUBLISHED DATE	REFERENCE	DESCRIPTION
March 30, 2017	ITB17-029	Original bulletin published.
April 6, 2017	ITB17-029a	SERVICE INFORMATION section revised.
January 16, 2019	ITB17-029b	SERVICE INFORMATION section revised.