

# **Technical Journal**

#### TITLE:

## **T8 P0EA773 Auxiliary Cooling System Performance**

REF NO: TJ 34123.1.3			CAR MARKET: United States and Canada		
10 04120.110	Teomineal Gervice	Omitou otatot	- and Ganada		
	PARTNER:	ISSUE DATE:	STATUS DATE:		
3 US 7	510 Volvo Car USA	2018-10-23	2018-10-31		
FUNC GROUP:	FUNC DESC:				
2647	Heater, thermostat	Page	1 of 3		

"Right first time in Time"

### **Attachment**

File Name	File Size		
US34123_Orientation_Illustration.JPG	0.0363 MB		

## **Vehicle Type**

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	('hassis range	Struc Week Range
2XX	BC						2016-9999		-	201526-209952
2XX	BR						2016-9999		-	201526-209952

## **CSC** Customer Symptom Codes

Code	Description
DL	Warning lights and chimes/Malfunction Indicator Light ("Check engine" light) indication/no indication

## **VST** Operation Number

VST Operation Number	Description	
26218-2	Thermostat, Cooling coil ERAD remove-install	

## DTC Diagnostic Trouble Codes

<b>Control Module</b>	Code	Fault Type		
ECM	P0EA773	Permanent		

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

## **Technical Journal 34123.1.3**



#### Text

#### **DESCRIPTION:**

\* This document has been rewritten in its entirety

If a vehicle experiences the code Engine Control Module (ECM) - P0EA773 "Auxiliary Cooling System Performance Mechanical Failures Actuator stuck closed" please follow the advice under service.

#### **SERVICE:**

A new component is now available for replacement and the old thermostat part number has been blocked. Do not install old stock on shelves.

Please order and install component 32139082.

Note: Orientation of the component is critical to correct operation. See attached photo US34123\_ Orientation Illustration.jpg

**To order the component**, please have the Parts Department contact Volvo Parts Ordering Support (Option 2). Please have the VIN number ready, as it will be mandatory for ordering.

#### **VEHICLE REPORT:**


Yes, please submit a Vehicle Report **if the service solution described in this TJ has no effect**. Use concern area "Vehicle Report" and sub concern area "Support needed", use function group 2647.

To view TJ attachment continue to next page. This TJ has one attachment.

Page 2 of 3 2018-10-31



# **Technical Journal 34123.1.3**

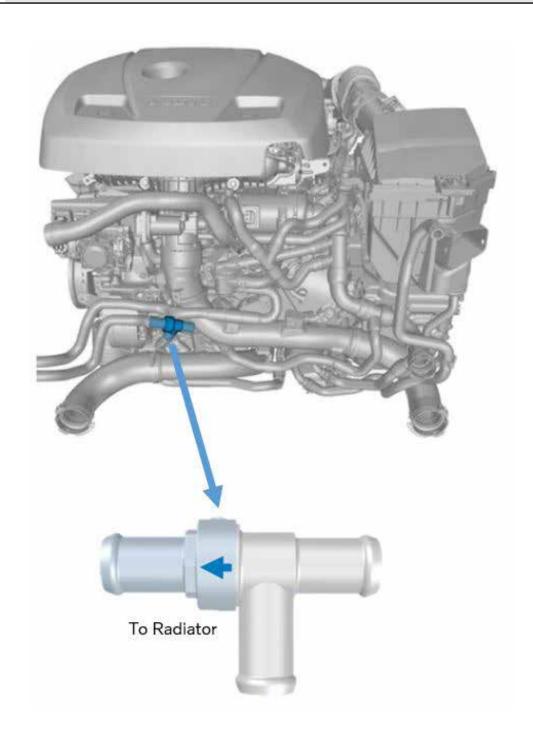

2018-10-31 Page 3 of 3