
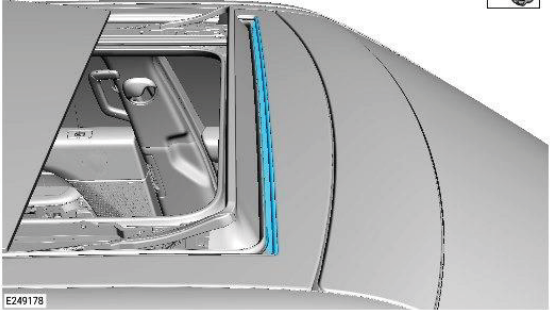
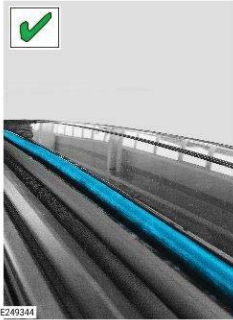
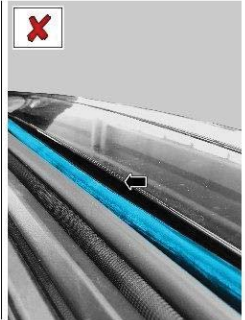


Latest Vehicle Concern Fixes



Wind Noise From Sunroof Area	Discovery 17 – 18MY
<p>Customer Voice:</p> <ul style="list-style-type: none">Customers may report a wind type noise emanating from the sunroof area at speeds above 40 mph. <p>Technical Description:</p> <ul style="list-style-type: none">This may be caused by a roof opening panel main seal that has become displaced and or a roof opening panel glass that is misadjusted. <p>Status:</p> <ul style="list-style-type: none">Should the roof opening panel main seal be found to be displaced, a procedure has been developed to reposition and bond the seal back into place.TSB LTB01306NAS1 will be published to address this concern. Should a customer express a concern, please refer to the TSB for repair guidance.	  <small>E249178</small>   <small>E249344</small>

