





MPD UPDATE

Electrical

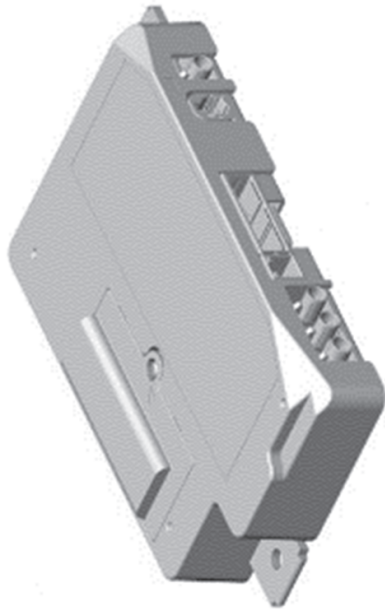

<p>Battery Drain Due to TCU</p> <p><u>Problem Description:</u></p> <ul style="list-style-type: none"> - Quiescent battery drain due to TCU module. <p><u>Current Status:</u></p> <ul style="list-style-type: none"> - If you remove the TCU fuse RF20 (5amp) within Rear Junction Box and the \approx 3 A draw is suppressed, please replace the TCU module and return the TCU fuse within the rear junction box. <p><u>Recommended Actions:</u></p> <ul style="list-style-type: none"> - Please replace the TCU and report via EPQR as the part needs to be returned for analysis. 		<p>16MY – 20MY RR Velar, RR Evoque, Discovery, Discovery Sport, RR Sport, Range Rover, F-Type, F-Pace, I-Pace, XE, XF & XJ equipped with InControl Touch Pro</p> 
KPI's		
Total VIN Count	Status	Issue Owner
		NAS: Richard Conte

 Solution Unavailable or project not yet accepted

 Solution known, not yet delivered

 Service Fix Available, Communication Published

