

Noises From Dynamic Seat

Topic number	LI91.25-P-071314
Version	1
Function group	91.25 Multicontour seat (MKS)
Date	06-15-2020
Validity	MODEL 213 with code 432 (Active Multicontour Seat Package) MODEL 257 with code 432 (Active Multicontour Seat Package) MODEL 290 with code 432 (Active Multicontour Seat Package)
Reason for change	
Reason for block	

Complaint:

When the dynamic seat is activated, the tensioning straps on the seat backrest frame may creak.

Cause:

The tensioning straps are in contact with the seat backrest frame and as a result, a creaking noise may occur.

Remedy:

Apply lubricant (Krytox) between the tensioning strap and the seat backrest frame, see figures.

Attachments	
File	Description
Bearbeitung Spannband 1.jpg	Processing of the stretch tape
Bearbeitung Spannband 2.jpg	Processing of the stretch tape

Symptoms
Body / Seat / Seat adjustment / Noise
Body / Seat / Multicontour seat / Noise
Body / Seat / Active multicontour seat / Noise

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 989 36 60			Lubricant - Krytox			X

Operation numbers/damage codes


XENTRY TIPS

Op. no.	Operation text	Time	Damage code	Note
			91N41 36	
			91A41 36	

Validity			
Vehicle	Engine	Transmission	
CLS (257)	*	*	
E (213)	*	*	
X 290 AMG	*	*	

Attachments

Bearbeitung Spannband
1.jpg:

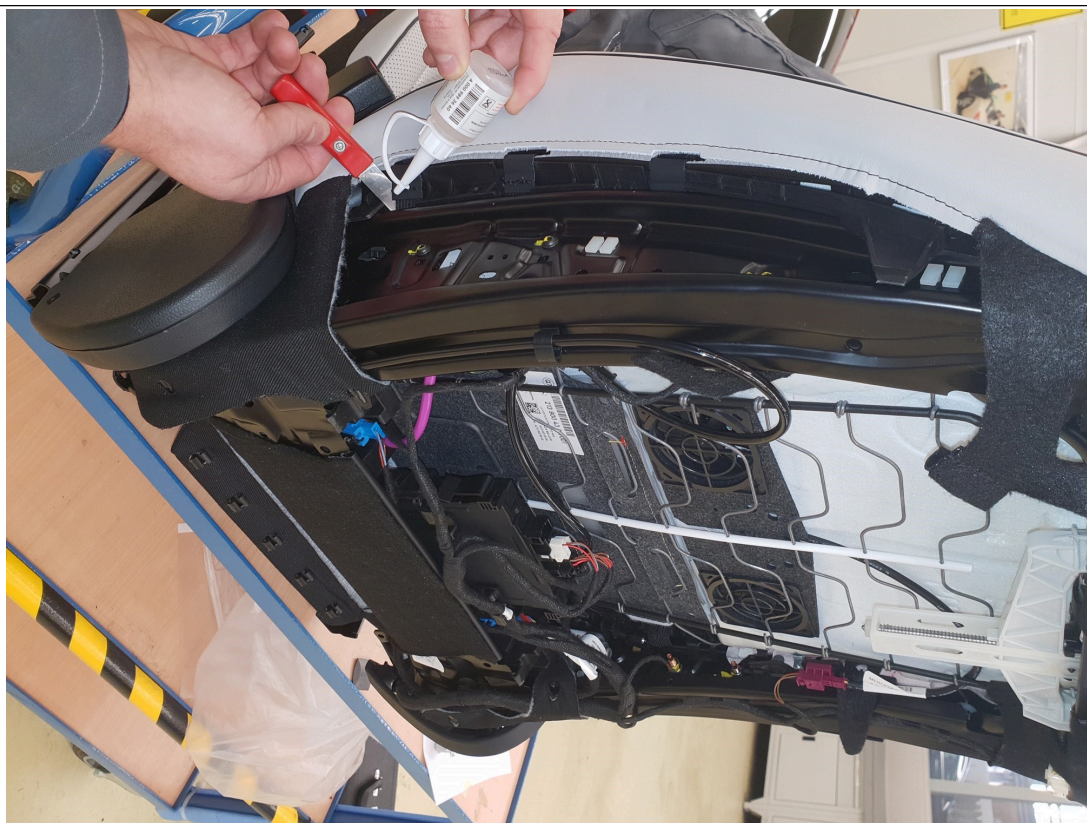

XENTRY TIPS

Bearbeitung Spannband
2.jpg:

