



SERVICE BULLETIN

Classification: EC15-002	Reference: NTB15-019	Date: March 16, 2015
-----------------------------	-------------------------	-------------------------

2015 ALTIMA; SERVICE INFORMATION – IGNORE DTCs 20A7 AND A0A7


APPLIED VEHICLE: 2015 Altima (L33)

SERVICE INFORMATION

If DTC 20A7 and / or A0A7 is found stored as Current or Past in an applied vehicle during any service – ignore it. DTCs 20A7 and A0A7 are not a malfunction and do not require any inspection, diagnosis, or parts replacement.

DTCs 20A7 and A0A7 may be set after using Remote Engine Start (RES) and has no effect on vehicle performance.

If performing service on any vehicle component or system on an applied vehicle, ignore DTCs 20A7 and A0A7 when performing appropriate diagnosis / repair procedures in accordance with the Electronic Service Manual (ESM).

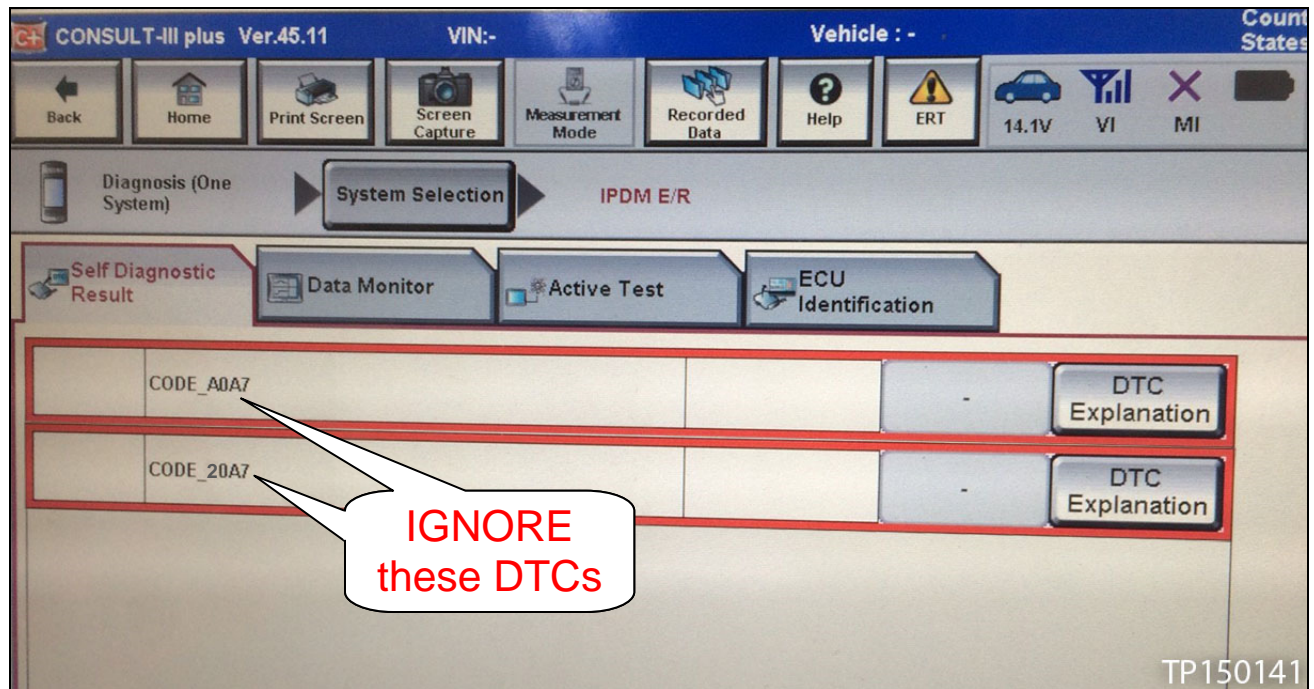

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.