


# TECHNICAL TOPICS

## BODY/CHASSIS



Blind Spot Monitor DTC U3000-78	21MY F-PACE
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"><li>- A customer may report a side object detection fault.</li></ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"><li>- A check for system DTCs finds DTC U3000-78 stored in either the right or left Side Object Detection Module (SODR or SODL). This may be caused by the incorrect side object detection module mounting bracket being installed on the vehicle.</li></ul> <p><u>Status:</u></p> <ul style="list-style-type: none"><li>- SSM 75578 has been published to address this concern, providing diagnostic guidance and part information.</li><li>- Please refer to this SSM should a customer express a concern.</li></ul>	

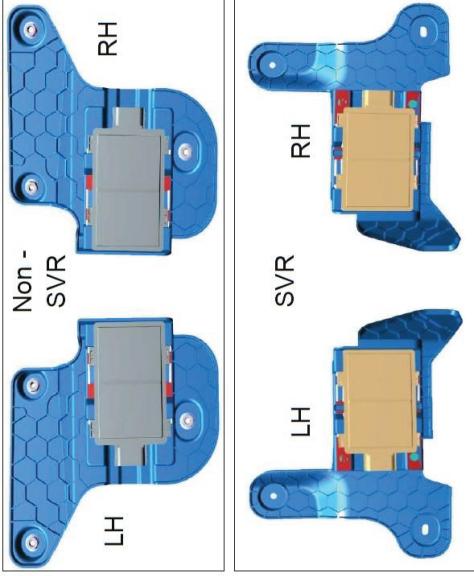

PRINTED COPIES ARE UNCONTROLLED