

RCA-72-22-001-1: Passenger Airbag Harness Pinch Condition



Rivian is initiating a customer satisfaction campaign for some model year 2022 R1T vehicles that may have been built with a pinch condition of the passenger airbag wire harness in the instrument panel. If the wires are damaged the airbag light will illuminate, indicating a fault in the system. Rivian is launching this campaign for customer satisfaction and for the continuous improvement of Rivian vehicles.

Document Type	Customer Satisfaction Campaign Bulletin
Date	January 13, 2022
Affected Region(s)	USA
Affected Model(s)	R1T
Model Year(s)	2022
Approximate Build Dates Refer to the FSA Dashboard to determine if this document applies to a specific vehicle.	August 2021 - September 2021
Vehicle System	72 - Occupant Protection
Minimum Service Location	Mobile

Procedure

1. Remove: Cover, Instrument Panel, Lower (refer to service manual procedure 641030010).

2. Make sure that no harnesses are routed forward of the airbag bracket. If necessary, route any harnesses out of the highlighted area.

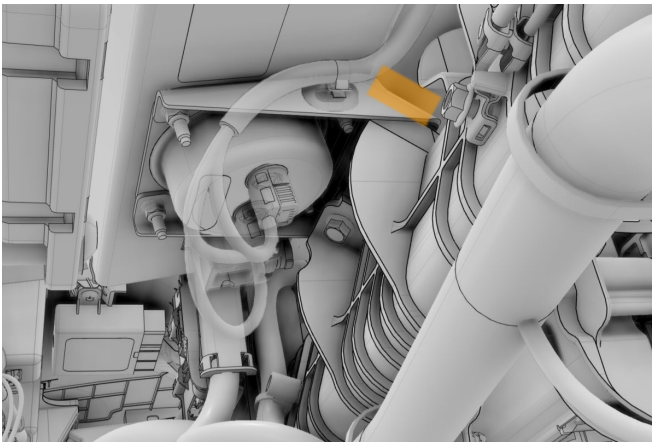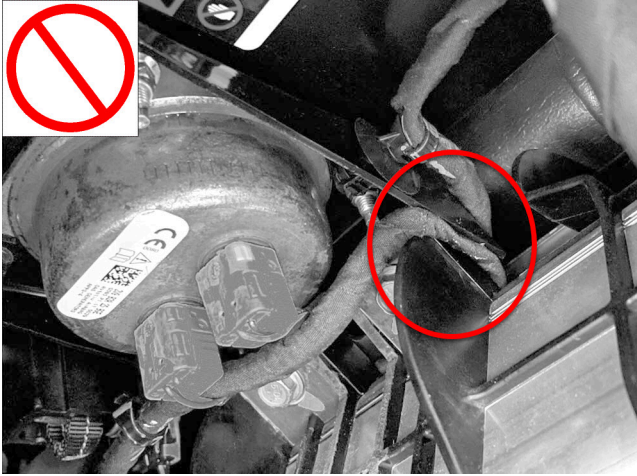

3. Reinstall all components that were removed for access.

Labor Codes

Labor Code	Description
RCA722200100	RCA-72-22-001-1 not applicable
RCA722200101	Inspect harness; no rerouting required
RCA722200102	Reroute harness to avoid pinch condition
Contact ServiceDocumentFeedback@rivian.com regarding labor codes and document content.	