



## Volvo Chassis - Windshield Wiper Function Inoperative In Intermittent Mode ONLY




> Internal Content

A partial containment will be for the installation of a jumper harness that contains a resistor to increase the current flow to the motor slip ring. Future containment will be a new cab harness that will have the resistor integrated.

**NOTE:** For trucks produced after 9 September 2019 (W1937), the aftermarket harness will not be needed.

For applicable vehicles exhibiting the symptom described above:

1. Order Harness Jumper 23522546.
2. Install the jumper harness as shown in the picture below.

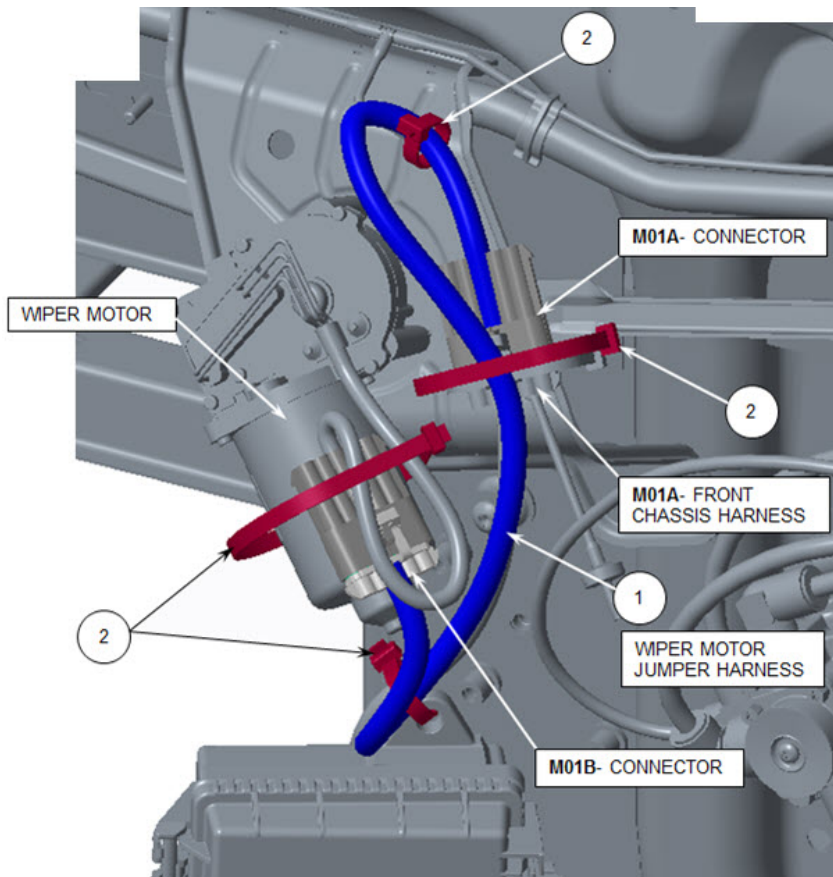

Live UI motor functionality after harness installation, typically the wiper motor does not need to be replaced.



Tags

[k51800139](#)

[volvo](#)

### Related links and attachments

No links or attachments available



### Feedback

[Give feedback](#)

to help improve the content of this article