




Volvo Chassis - Model VNX - One piece Propeller Shaft (Drive Shaft) Contacts Cross Member



> Internal Content

The yoke of the one piece propeller shaft (Drive Shaft) MAY contact the back to back "C" channel cross member under acceleration and/or suspension articulation. The solution would be to flip-flop the propeller shaft end for end. This will give the necessary clearance.

Please refer to the images below:

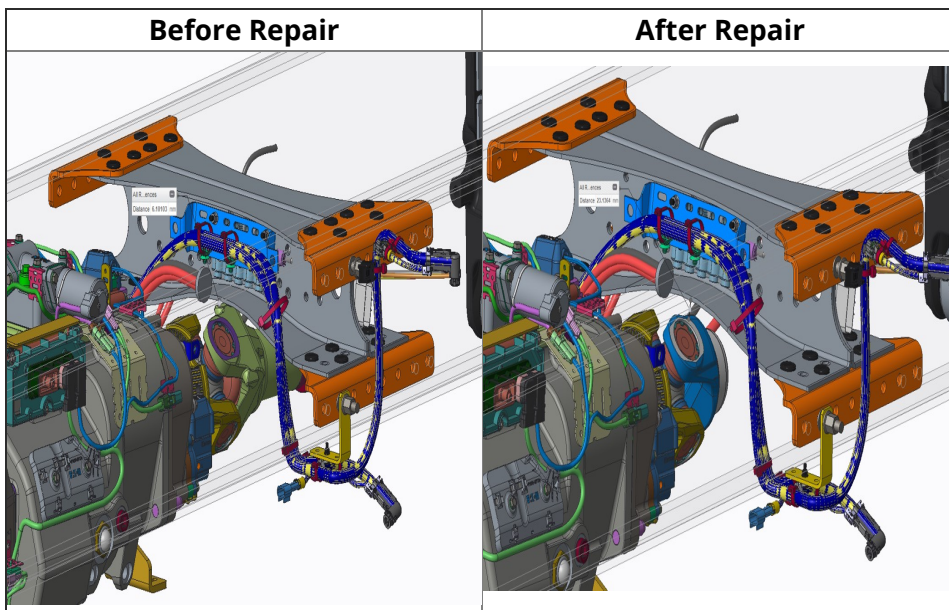

Tags

[k82503549](#)

[vnx](#)

[cu15](#)

[manual](#)

[eaton fuller](#)

[volvo](#)

Live UI

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article