IMPACT 4.07.140 7/5/2022

Printed by:William Cheek

Service

Chassis ID Path

2651/Technical service bulletins//Charge Air Cooler Revision

Model Identity

164544237

Publish date ID/Operation 6/30/2022 M-265-001

IMPACT 4.07.140 7/5/2022

Charge Air Cooler Revision

M-265-001

June 2022


Valid for

All CXU, CHU, & GU Models built before May 2007

Case description

A revised charge air cooler (part Nos. 20956580 and 20956585) was implemented into production on all CXU, CHU and GU model chassis. This revised charge air cooler includes a redesigned upper mounting area, whereby the shoulder bolt and bushing arrangement was changed to sleeved washers and mounting bolts. Should replacement of a charge air cooler on a CXU, CHU and GU model manufactured prior to May 2007 be required, the existing shoulder bolts and bushings must be replaced with the sleeved washers and mounting bolts. An upper mounting hardware kit (part No. 85111312), which contains four sleeved washers and four mounting bolts, is available through the MACK Parts System.

Repair

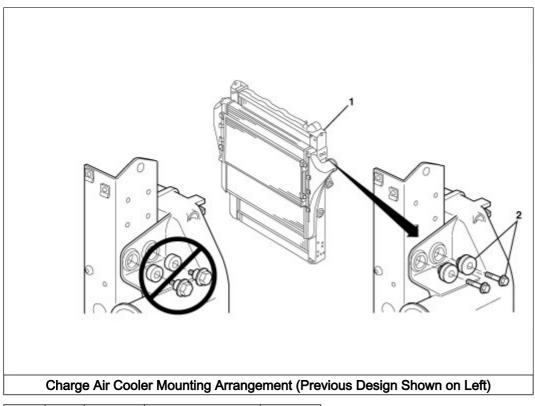

	Key	Qty.	Part No.	Description	Replaces
Ī	1	1	20956580	Charge air cooler,	20750095
				long	
		1	20956585	Charge air cooler,	20750102
				short	
ſ	2	1	85111312	Kit, upper	
				mounting	

Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written consent by the Volvo Group

IMPACT 4.07.140 7/5/2022

	hardware	
	(includes four	
	bolts and four	
	sleeved washers)	

Issued by

Technical Service

Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written consent by the Volvo Group