

Correction

## **Service Bulletin**

Bulletin No.: 21-NA-212

Date: November, 2022

## **INFORMATION**

Subject: Information on Power Front Seat Adjuster Track Service Part Availability Separate from Complete Seat Cushion Frame Assembly

| Brand:    | Model:            | Model Year: |      | VIN: |    | Engine  | Transmission: |
|-----------|-------------------|-------------|------|------|----|---------|---------------|
|           |                   | from        | to   | from | to | Engine: | Transmission. |
| Cadillac  | XT4               | 2019        | 2023 |      |    |         |               |
| Chevrolet | Malibu<br>(VIN Z) | 2016        | 2016 | _    | _  | All     | All           |
|           | Malibu            | 2017        | 2023 |      |    |         |               |


| Involved Region or Country | North America, Chile, Europe, Israel, Middle East, Egypt, GM Korea Company, Cadillac Korea (South Korea)  |  |  |  |
|----------------------------|---|--|--|--|
| Information                | If there are issues with fore/aft movement, binding or other conditions of the power front seat adjuster track, and the diagnosis leads to front seat adjuster track replacement, the front seat adjuster track has been released as a service part (no longer serviced by the complete seat cushion frame assembly). |  |  |  |
|                            |   |  |  |  |

**Note:** Do not replace the complete seat cushion frame assembly for a seat track movement condition.



5902829

**Caution:** To remove the new power front seat adjuster track from the shipping container, lift it up with one hand on each track. Do not lift the power front seat adjuster track by holding the bridge; it may cause damage to the material.

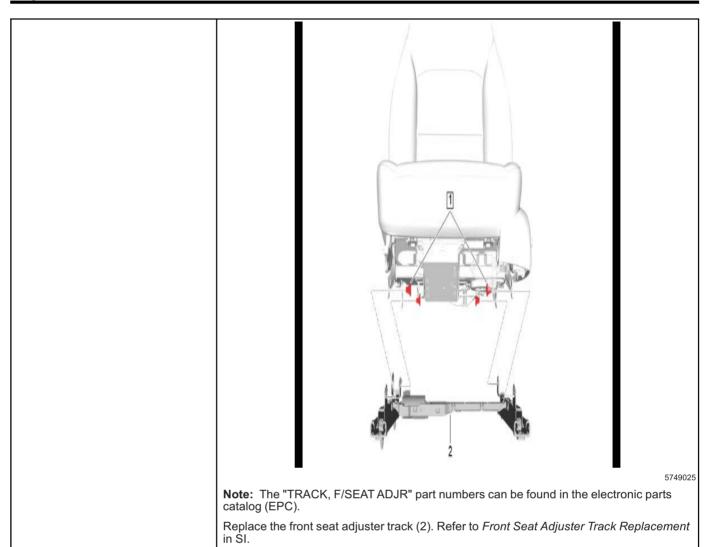

| Version  | 3  |
|----------|--|
| Modified | Released September 17, 2021                                  |
|          | Revised April 25, 2022 – Reworded second Note in Correction. |
|          | Revised November 21, 2022 – Added the 2023 Model Year.       |