



STAR ONLINE PUBLICATION



Case Number: S2108000165 Rev. A

Release Date: August 2022

Symptom/Vehicle Issue: MIL Lamp Is On, Multiple Glow Plug DTC's

Customer Complaint/Technician Observation: Owner complains that the MIL (Malfunction Indicator Lamp) lamp is on in the cluster. Technician Observed the vehicle may have set multiple DTC's P052F-00 GLOW PLUG CONTROL MODULE 1 SYSTEM VOLTAGE, P0671, P0672, P0673, P0674, P0675, P0676-CYLINDER 1-6 GLOW PLUG CIRCUIT OPEN.

Repair Procedure: With multiple glow plug DTC's, inspect the main B+ feeds and grounds to the GLOW plug module prior to any other repairs. Review inline connector XY203A Brown/2way for the A29 circuit, and/or perform a voltage drop test to identify any loss of power supply if needed Fig 1, 2. Verify the XY203A connector is fully connected and seated.

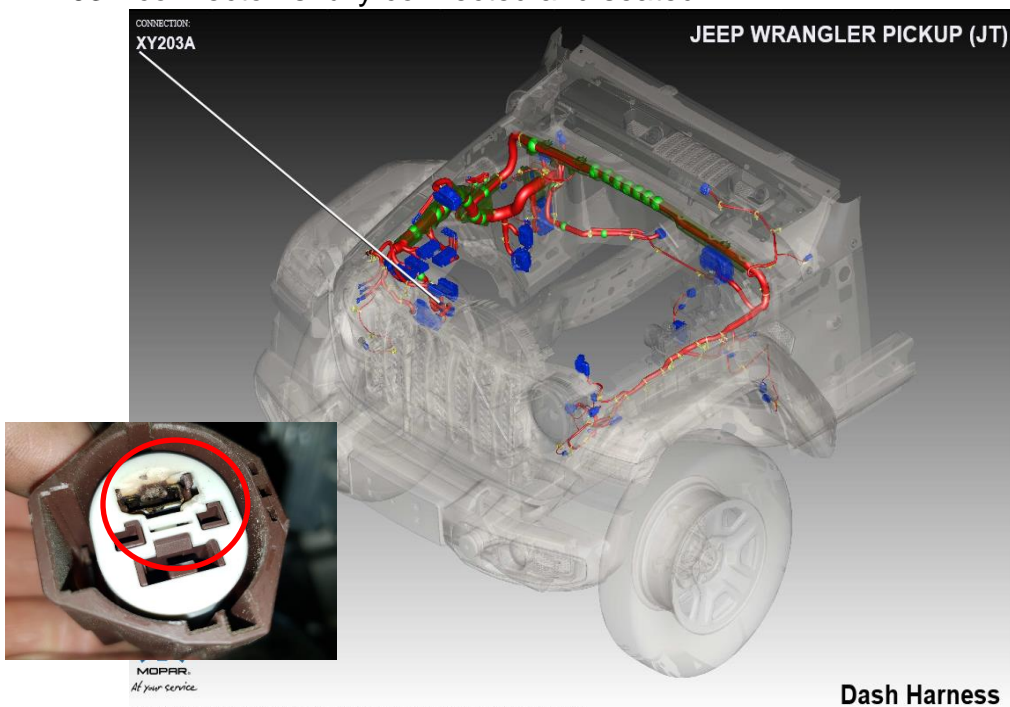


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found



STAR ONLINE PUBLICATION

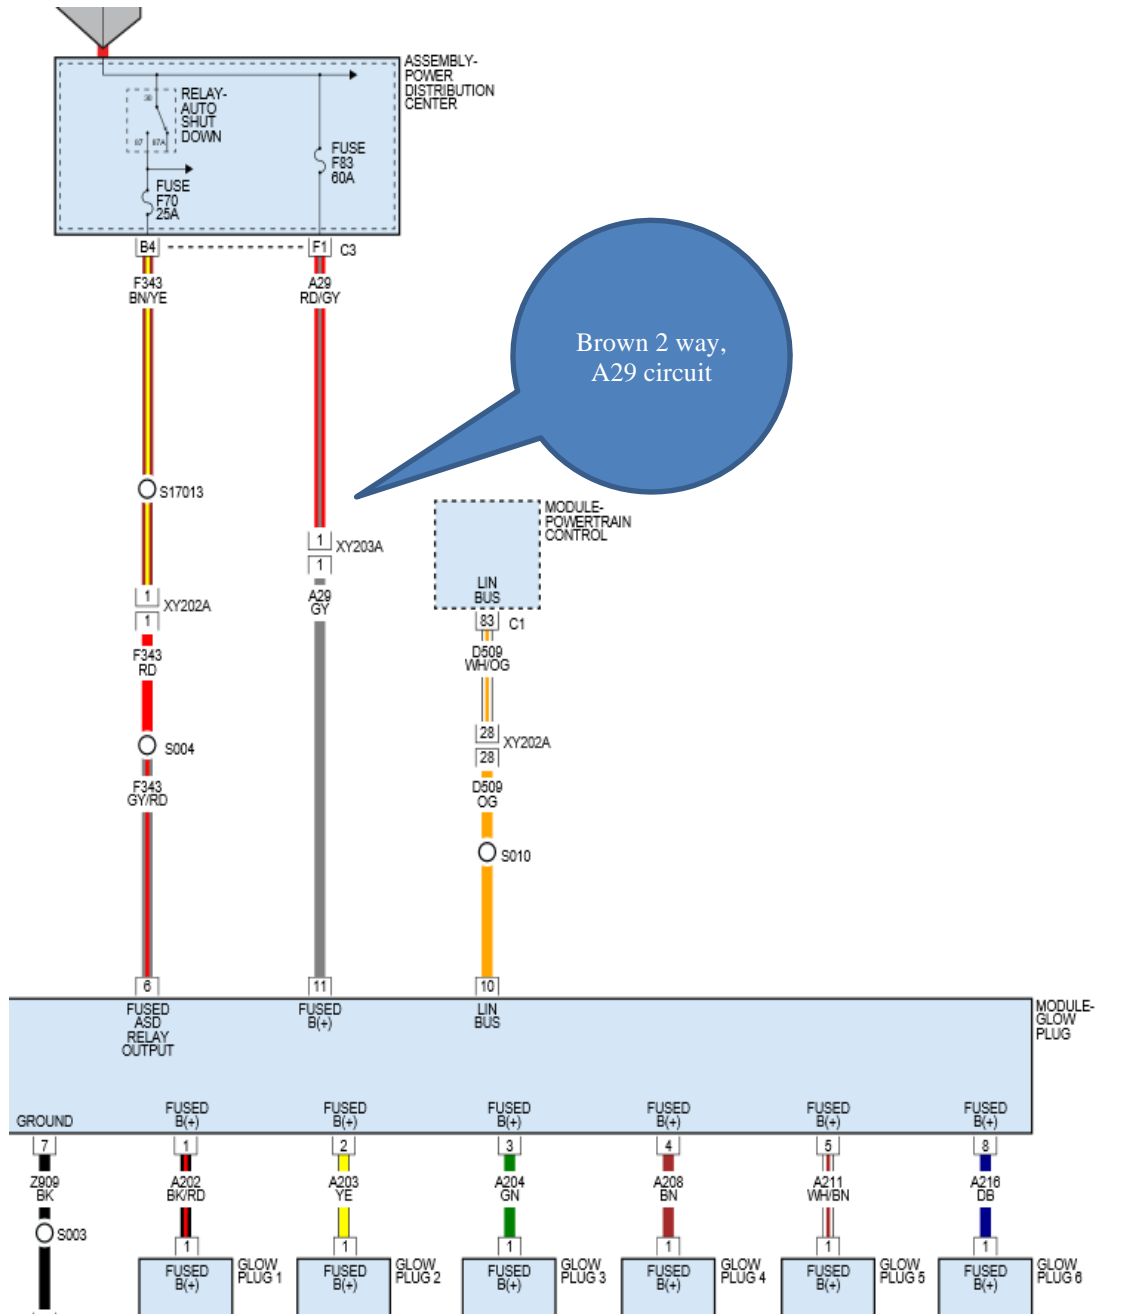


Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found