

43 DTC U112100 stored in the suspension control unit - J775

43 23 71 2067283/2 May 19, 2023. Supersedes Technical Service Bulletin Group 43 number 22-61 dated June 9, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 – 2024	All	Not Applicable

Condition

REVISION HISTORY			
Revision	Date	Purpose	
2	-	Revised <i>header</i> (Added Model Year)	
1	06/06/2022	Initial publication	

Customer states:

No customer concerns, it is found during PDI or any other diagnostic work.

Workshop findings:

The following DTCs are logged in J775 suspension control unit (diagnostic address 0074):

- U112100 Data bus missing message_(active/static symptom code 262222).
- U112100 Data bus missing message_(active/static symptom code 262256).
- U112100 Data bus missing message_(active/static symptom code 262258).

Technical Background

Not Applicable

Production Solution

Not Applicable


Service

If only the DTCs described above are logged in address 0074, do <u>not</u> perform any repair work. These DTCs have <u>no</u> effects on the suspension system..

Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

^{© 2023} Audi of America, Inc.

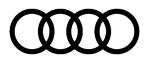

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Additional Information

All part and service references provided in this TSB (**2067283**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

© 2023 Audi of America, Inc.

Page 2 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.