



STAR ONLINE PUBLICATION




Case Number: S2319000007

Release Date: September 2023

Symptom/Vehicle Issue: Squeak Noise From Dash Area When Turning The Steering Wheel.

Discussion: Inspect the steering shaft bearing installed in the front bulkhead. The bearing is marked left-hand drive (LHD) or right-hand drive (RHD) to identify its application. If the bearing is not a correct match for the vehicle, a noise may result when turning the steering wheel. Replace the bearing if it does not match the application. See figures below.

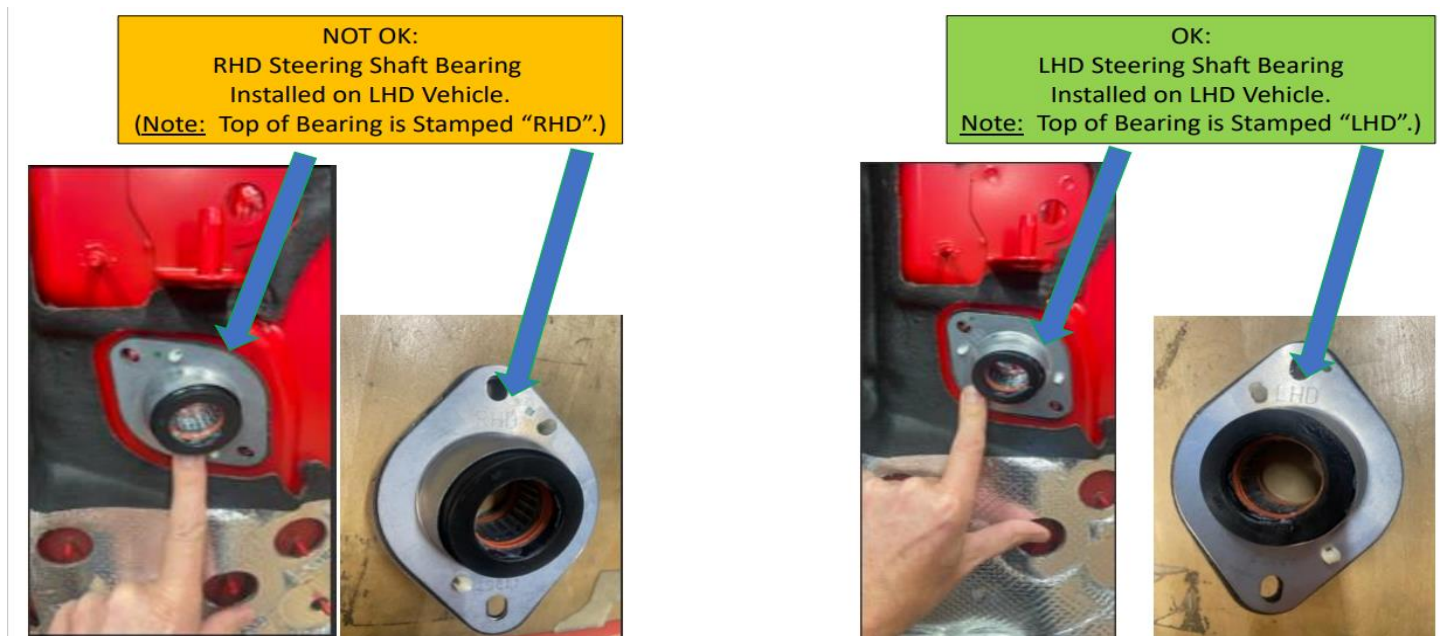

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.