Advanced Full Text Search - TIBU7108 - Required Parts Needed for Attaching New Fuel... Page 1 of 3 SB-10052476-5043

C&TERPILLAR*	Service Information Syst	Shutdown SIS
Previous Screen		
<ul> <li>Product: NO EQUIPMENT SELECTED</li> <li>Model: NO EQUIPMENT SELECTED</li> <li>Configuration: NO EQUIPMENT SELECTED</li> </ul>		
Technical Information Bullet Required Parts Needed for Attachi {7000}		60 On Highway Truck
Media Number -TIBU7108-00 Caterpillar: Confidential Yellow	Publication Date -29/05/2013	Date Updated -29/05/2013

i05349515

## Required Parts Needed for Attaching New Fuel Sender to the CT660 On Highway Truck{7000}

**SMCS -** 7000

**On Highway Truck:** 

CT660 (S/N: TRK1-UP; TKL1-UP; TGT1-UP; TSW1-UP; TSY1-UP; TJS1-UP)

## Introduction

Three parts are required to connect updated fuel sender to the truck harness.

## Problem

Early version of fuel sender had pigtail style connector. New style has a fixed style connector that requires three additional parts to connect to harness.

## **Solution**

Trucks that were built with a pigtail, and you receive a fuel sender without a pigtail you will need three additional parts to make the existing truck harness mate with the fuel sender.

Table 1				
Item	Qty	New Part Number	Part Name	
1	1	396-2766	Body - Connector	
2	1	396-2770	Terminal - Female	

I			
3	1	422-4504	Harness Assembly Jumper



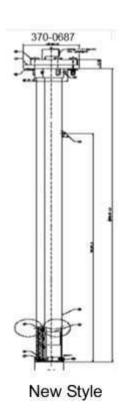


Illustration 2

g03388384

Copyright 1993 - 2013 Caterpillar Inc. All Rights Reserved. Private Network For SIS Licensees. Wed Jun 5 11:53:40 CDT 2013