

Technical Service Bulletin Number	Revision Level	Date	Group Number
TSB130017			



Technical Service Bulletin

Subject


ISX12 CM2350 X102 and ISX15 CM2350 X101 - Missing OEM Fuse Causing Diesel Exhaust Fluid (DEF) Line Heater Fault Code 3258 in PACCAR™ Chassis (Peterbilt™ 579 and Kenworth™ T680)

Issue

The fuse that powers the DEF line heater relay was **not** installed on some ISX12 CM2350 X102 and ISX15 CM2350 X101 PACCAR™ trucks. The fuse panel label does **not** specify a fuse is needed in the required terminal.

Verification

Inspect the "L10" location in the fuse panel for a fuse. Units built without the fuse for the DEF line heater relay will have active Fault Code 3258.

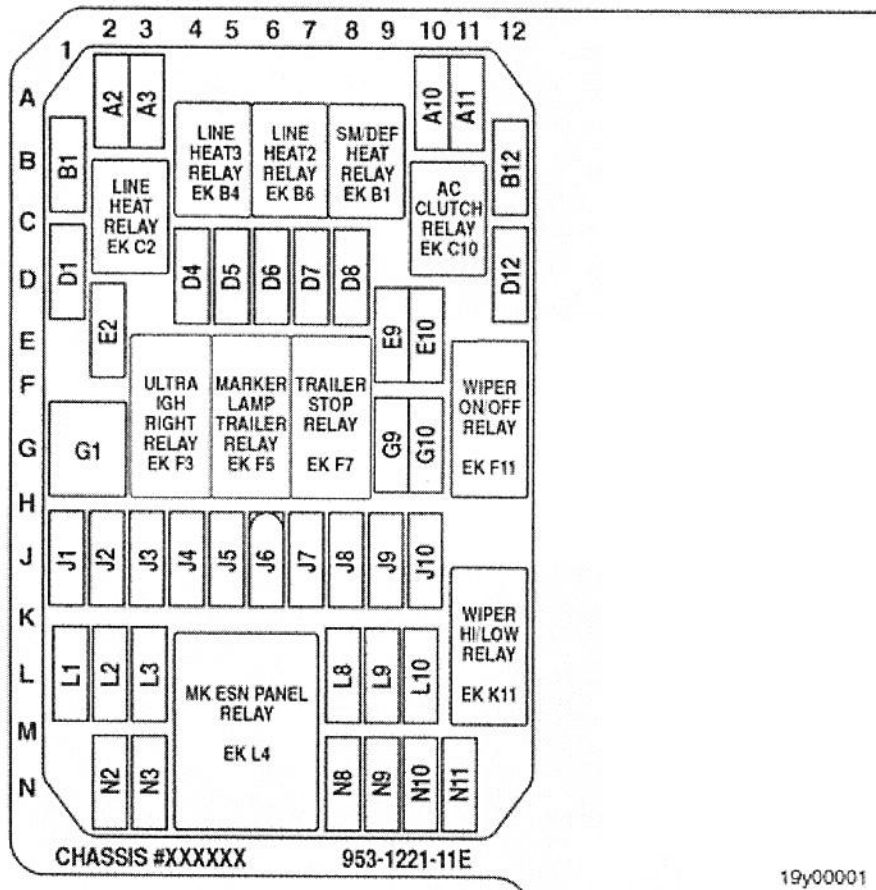

19y00001

Resolution

Contact the original equipment manufacturer (OEM) for repair direction.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Document History

Date	Details
2013-1-21	Module Created

Last Modified: 30-Jan-2013