Service Bulletin Mazda North American Operations

Irvine, CA 92618-2922



© 2014 Mazda Motor of America, Inc.

Subject:

SEAT CUSHION TRIM COMING APART AT SEAMS - (CLOTH SEATS ONLY)

Bulletin No: 09-029/14


Last Issued: 07/03/2014

APPLICABLE MODEL(S)/VINS

2010-2013 Mazda6 vehicles equipped with cloth seats

DESCRIPTION

Some vehicles may exhibit a condition where the front and/or rear seat cushion trim is coming apart at the seams.

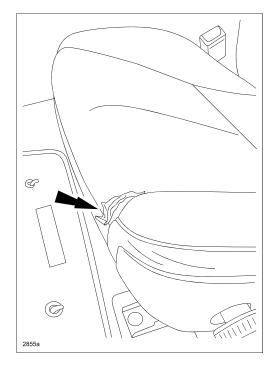

Seat cushion trim(s) with increased strength are available to eliminate this concern.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

- 1. Verify the customer concern.
- 2. Replace only the affected seat cushion trim(s) with a new one according to the instructions on MS3 online or the Workshop Manual (section 09-13 FRONT SEAT CUSHION TRIM REMOVAL/INSTALLATION) and/or (section 09-13 REAR SEAT CUSHION TRIM REMOVAL/INSTALLATION).
- 3. Verify the repair.

Page 1 of 2

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in

Bulletin No: 09-029/14	Last Issued: 07/03/2014
© 2014 Mazda Motor of America, Inc.	

PART(S) INFORMATION

Part Nu	ımber			
New	Old	Description	Qty.	Notes
GEY0-88-161	GEG1-88-161 -02	Front seat cushion trim	1	Driver side STA (Black)
GEY1-88-161	GEG1-88-161 -30	Front seat cushion trim	1	Driver side STA (Beige)
GEY2-88-161	GEG2-88-161 -02	Front seat cushion trim	1	Driver side STB (Black)
GEY3-88-161	GEG2-88-161 -30	Front seat cushion trim	1	Driver side STB (Beige)
GEY0-88-111	GEG1-88-111 -02	Front seat cushion trim	1	Passenger side (Black)
GEY1-88-111	GEG1-88-111 -30	Front seat cushion trim	1	Passenger side (Beige)
GEY0-88-201	GEG1-88-201 -02	Rear seat cushion trim	1	Rear seat (Black)
GEY1-88-201	GEG1-88-201 -30	Rear seat cushion trim	1	Rear seat (Beige)

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А	
Symptom Code	87	
Damage Code	9A	
Part Number Main Cause	(SEE PART(S) INFORMATION)	
Quantity	1	
Operation Number / Labor Hours:	XXJDHXRX / 0.9 Hrs. (Front seat / one side) XXJDJXRX / 1.5 Hrs. (Front seat / both sides) XXJDKXRX / 1.5 Hrs. (Rear seat) XXJDLXRX / 2.1 Hrs. (Front seat / one side and rear seat) XXJDMXRX / 2.7 Hrs. (Front seat / both sides and rear seat)	

NOTE:

- This bulletin only applies to vehicles with cloth seats.
- Replace only the affected seat cushion trim(s).