

Classification:

EL16-020

Reference: NTB16-119

December 1, 2016

Date:

2013 - 2016 ALTIMA; RUST AROUND REAR LICENSE LAMP FINISHER

APPLIED VEHICLE: 2013 – 2016 Altima (L33)

IF YOU CONFIRM

When rust is found on the rear deck lid surface in the area surrounding the license lamp finisher (Figure 1) or replacing the license lamp finisher for any reason.

ACTION

- Replace the license lamp finisher with the new replacement part listed in the Parts Information.
 - Refer to the Electronic Service Manual (ESM), section EXT Exterior for removal and installation information.
- Repair any damaged surfaces that were in direct contact with the license lamp finisher.

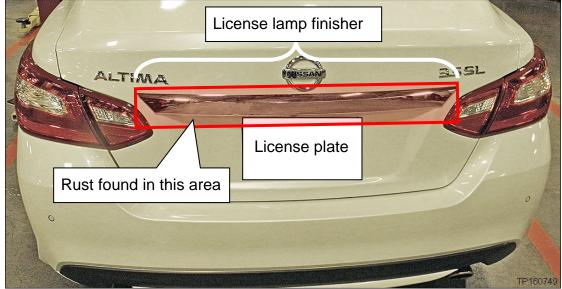


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

MODEL YEAR	TRIM LEVEL	DESCRIPTION	PART NUMBER	QUANTITY	
2013-2015 Altima	Base	License Lamp Finisher Without Camera Without Switch	84810-3TA2C	1	
	S	License Lamp Finisher Without Camera With Switch	84810-9HM2A	1	
	S,SV,SL	License Lamp Finisher With Camera With Switch	84810-9HM2B	1	
2016 Altima	Base	License Lamp Finisher Without Camera	84810-9HS2A	1	
	S,SV,SL, SR	License Lamp Finisher With Camera	84810-9HS2C	1	

CLAIMS INFORMATION

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace License Lamp Finisher	(1)	UM30AA	ZA	03	(2)

OR

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace License Lamp Finisher		UM30AA			(2)
Refinish Trunk Lid-Half Block Repair	(1)	ZL1GAA	ZA	03	(3)
Preparation & Mixing Time		ZZ99AA			(3)

(1) Reference the Parts Information Table and use the applicable Finisher as the PFP.

(2) Reference the current Nissan Warraty Flat Rate Manual and use the indicated FRT.

(3) Reference the current Nissan Warranty Paint Flat Rate Manual and use indicated FRT.

NOTE: Use expense code 019 for paint materials.