M-Tips

Mazda North American Operations Irvine, CA 92618-2922



Subject:


2004-2009 MAZDA3 (5-DOOR) - HAZY REAR COMBINATION LAMP LENS

M-Tips No.: MT-013/17

Last Issued: 07/06/2017

DESCRIPTION


On some vehicles, the rear combination lamp lens becomes hazy and looks white when the brake or taillight is on.

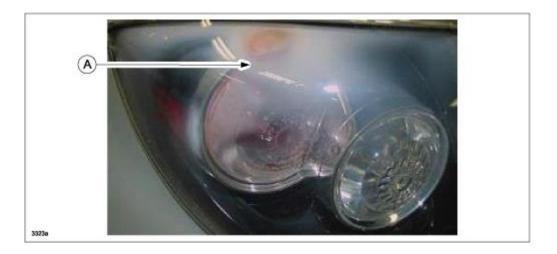


Page 1 of 3

 $An \ editorial \ board \ comprised \ of \ MNAO \ service \ staff \ members \ generates, \ collects, \ and \ verifies \ information \ for \ this \ publication.$

Due to heat accumulated by extended brake light (E) usage, the red inner cap(A) is melted (B) and the inner (C) and/or outer (D) lens becomes hazy.

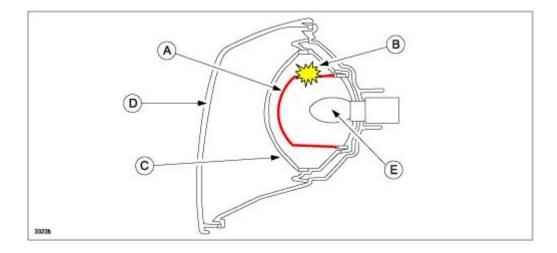

Customers having this concern should have both rear combination lights replaced with modified ones(red inner cap (A) is eliminated and red inner lens (B) is used).

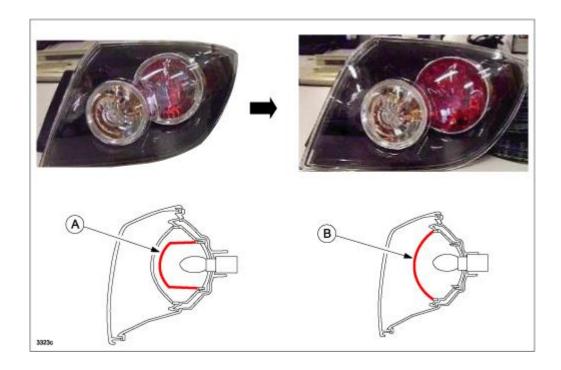

Page 2 of 3

An editorial board comprised of MNAO service staff members generates, collects, and verifies information for this publication.

To contribute repair tip ideas, send an e-mail to mtips@mazdausa.com. All contributions become property of MNAO, which assumes permission to publish them without further consideration.

| M-Tips No.: MT-013/17 | Last Issued: 07/06/2017 |
|-----------------------|-------------------------|

PARTS INFORMATION

| Part Number | Description |
|-------------|--------------------------------|
| BWYD-51-170 | Rear combination light (right) |
| BWYD-51-180 | Rear combination light (left) |