

Document Number TS-WI-0249

CARB LABEL INSPECTION AND REPLACEMENT

ASSEMBLY AREA	Field Repair
MODEL	2008-2016 Model Chrysler Town and Country and Dodge Grand Caravan,
	2017 Model Dodge Grand Caravan

RELEASE SIGNATURES

TITLE	SIGNATURE	DATE	
QUALITY DIRECTOR	Brian Mark	9/15/2017	
DEPARTMENT MANAGER	Dave Hagstrom	9/15/2017	
COMPLIANCE ENGINEER	Leslie Reynolds	9/15/2017	

REVISION HISTORY

AUTHOR	DESCRIPTION OF CHANGE	REV	RELEASED	ECO#
Dave Hagstrom	Initial Release	Α		



Document Number TS-WI-0249

SCOPE


Some 2008-2017 Model year Chrysler Town and Country and 2017 Dodge Grand Caravans <u>built</u> <u>between from 10/28/2016 to 3/13/2017</u> may have the incorrect CARB Executive Order (EO) number typed into the VMI label attached to the fuel tank. This letter will provide inspection criteria and replacement instructions if the label is incorrect.

CONTENTS

 Identify the VMI Build date by inspecting the white sticker located on the driver's side door jamb

 If the vehicle's VMI build date falls between 10/28/2016 to 3/13/2017 locate the fuel tank label located on the driver's side on the vehicle.

(see picture for examples)

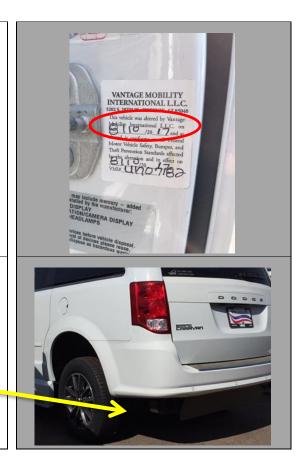



Document Number TS-WI-0249


- 3) Locate the Calif. ARB EXEC. ORDER NO.
- 4) If the number is D417-53;
 YOU HAVE NO FURTHER ACTION

IF the number is NOT D417-53;

- a. take a picture of the incorrect label and contact VMI Tech Support.
- b. Send a copy of the picture along with the VIN and a request for a replacement label.
- Do Not remove the incorrect label until you have the replacement ready to install
- 5) AFTER RECEIPT of the correct label, carefully remove the discrepant label using your fingers or a PLASTIC PUTTY KNIFE

IMPORTANT

Do NOT use any tool that can cause damage to the tank or generate any sparks

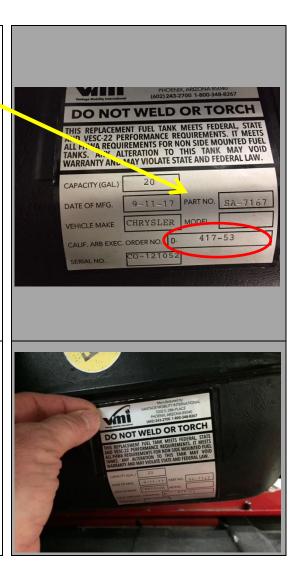



Document Number TS-WI-0249

6) Carefully clean the area where the replacement label will be placed. Make sure to clean and dry an area LARGER than the label to ensure proper adhesion.

IMPORTANT
Do NOT use any solvent based cleaners

7) Apply the replacement label in the cleaned area making sure there are no air pockets under the label after application.





This document may not be reproduced without permission. Check all hard copies against the current electronic version in the Document Control System before using. Destroy promptly thereafter.

Do not use draft, archived, or obsolete revisions.