



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-237

Date: July, 2017

TECHNICAL

Subject: Wet Floor or Interior Water Leak due to HVAC Drain Hose

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2010	2017			All	All
GMC	Terrain	2010	2017			All	All

Involved Region or Country	North America, Middle East, Israel
Condition	Some customers may comment on an interior water leak and/or the floor is wet. During diagnosis a technician may find that the leak is due to the HVAC drain hose.
Cause	This may be due to the older design drain hose being a smaller diameter that is prone to clogging.
Correction	Replace the drain hose with newly designed drain hose.


Parts Information

Description	Part Number	Qty
HOSE ASM-A/C EVPR & BLO MDL DRN	84272147	1

Warranty Information

Labor Operation	Description	Labor Time
4414290	Air Conditioning Evaporator and Blower Module Drain Hose Replacement	Use Published Labor Operation Time

Service Procedure

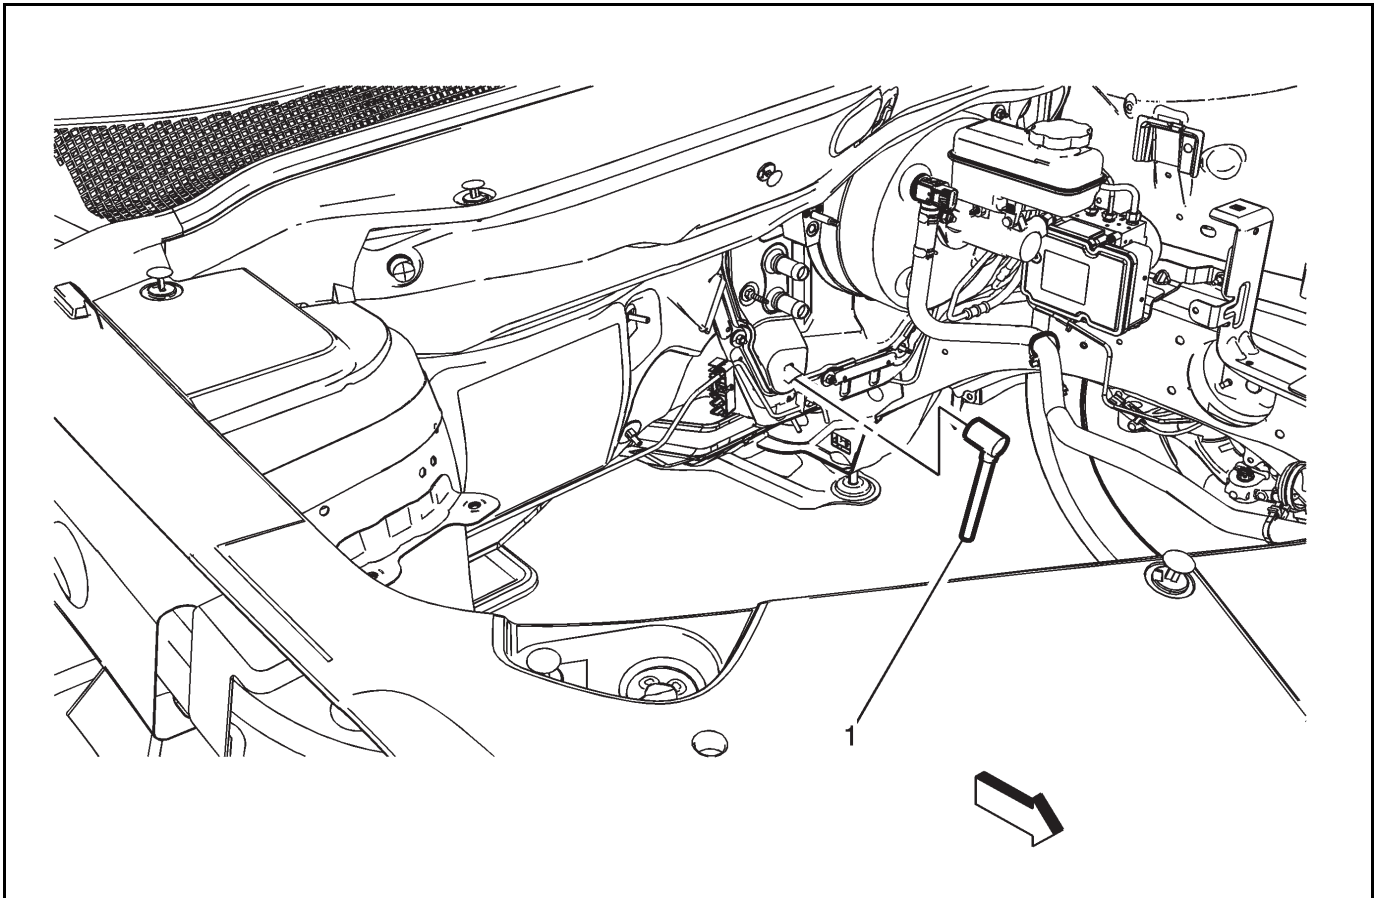

2912899

If you encounter a vehicle with the above concern, replace the drain hose. Refer to *Air Conditioning Evaporator and Blower Module Drain Hose Replacement* in SI.

Version	1
Modified	

