

Technical product information

Topic	Dynamic ride system warning - momentarily displayed
Market area	Bentley: worldwide (2WBE),Hongkong-Macau (5HK)
Brand	Bentley
Transaction No.	2050647/1
Level	EH
Status	Approval
Release date	

New customer code

Object of complaint	Complaint type	Position
running gear -> shock absorber/suspension control -> roll compensation	functionality -> defective function sequence	

New workshop code

Object of complaint	Complaint type	Position
running gear -> actuation, dynamics and braking controls -> control unit for anti-roll bar decoupling	concept -> arrangement concept error	

Vehicle data

Bentayga

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
4V1*	2017	E		*	*	*
4V1*	2018	E		*	*	*
4V1*	2019	E		*	*	*

Documents


Document name
master.xml

Dynamic ride system warning - momentarily displayed

Customer statement / workshop findings

Bentley dynamic ride system warning momentarily displayed

Technical background

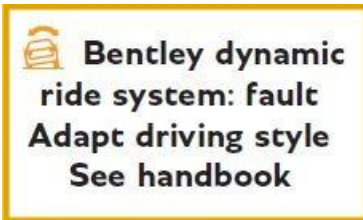

During specific driving conditions the Bentley dynamic ride system warning may momentarily display in the driver information panel.

Production change

N/A

Measure

In the event that a customer reports the above symptom check for Diagnostic Trouble Codes (DTCs) logged in Roll Bar Actuators D4 and D5.

If DTC BF200E Internal malfunction is logged with the specific symptom 12677125 C17005 set as passive/sporadic in either D4 or D5 then no further action is required.

Customer information

Explain to the customer that the momentary display of this specific symbol is not due to a fault in the Bentley dynamic ride system but a normal output from a correctly functioning system during specific drive conditions