


## No Communication with the Immobilizer Control Unit-Receiver?

### AFFECTED VEHICLES

2005–12 RL

Can't get past **this** screen when adding keys with the **Immobilizer Setup Tool** in the i-HDS?

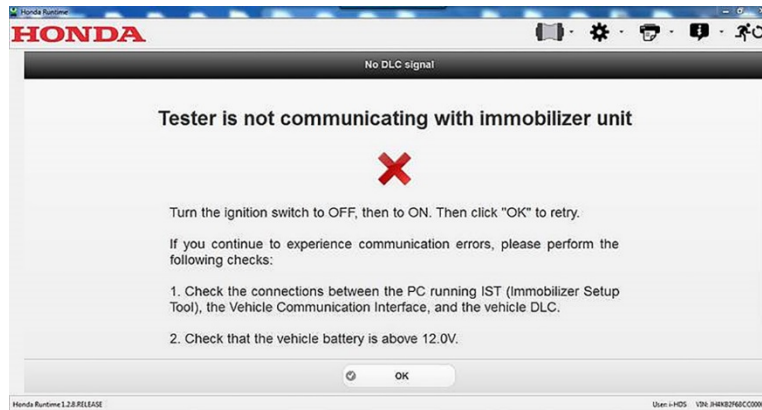

Here's an easy workaround to restore communication.

1. Release the built-in key from the keyless access remote.
2. Remove the ignition switch cover. To do this, just insert the key into the slot in the bottom of the cover, push the key all the way in, then pull out on the cover and the key.
3. Insert the key into the ignition switch, then turn it to ON.
4. Select **OK** on the i-HDS screen to continue.
5. If there's still no communication, call the Special Tools Hotline at **800-346-6327** for support.

You'll also find this covered in SIS. Select **General Publications > Tool Information > Diagnostic and Reprogramming > i-HDS Known Issues List > No Communication with Immobilizer Unit on 2005–2012 Acura RL.**