

## Windshield washer system spray nozzle on engine hood loose

Topic number	LI82.35-P-063732
Version	1
Design group	82.35 Windshield washing system
Date	03-28-2016
Validity	253, 213
Reason for change	
Reason for block	

### Complaint:

Windshield washer system spray nozzle on engine hood loose (Figure 1)

Attachments	
File	Description
Bild1.JPG	Spray nozzle loose (example on BR 253, outer right)

### Cause:

Tolerance for mounting holes in engine hood

### Remedy:

Apply adhesive pad onto long catch tab of spray nozzle (Figures 2 and 3)

Attachments	
File	Description
Bild2.jpg	Position of adhesive pad on long catch tab of spray nozzle
Bild3.jpg	Spray nozzle with adhesive pad attached

### Symptoms

Overall vehicle / Cleaning system / Windshield washer system / Windshield washer nozzle does not spray

### Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 211 835 00 88			Label	1	One adhesive pad is required for each spray nozzle	X

### Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note

# XENTRY TIPS

		88201 42	
--	--	----------	--

## Attachments

Bild1.JPG:



# XENTRY TIPS

Bild2.jpg:

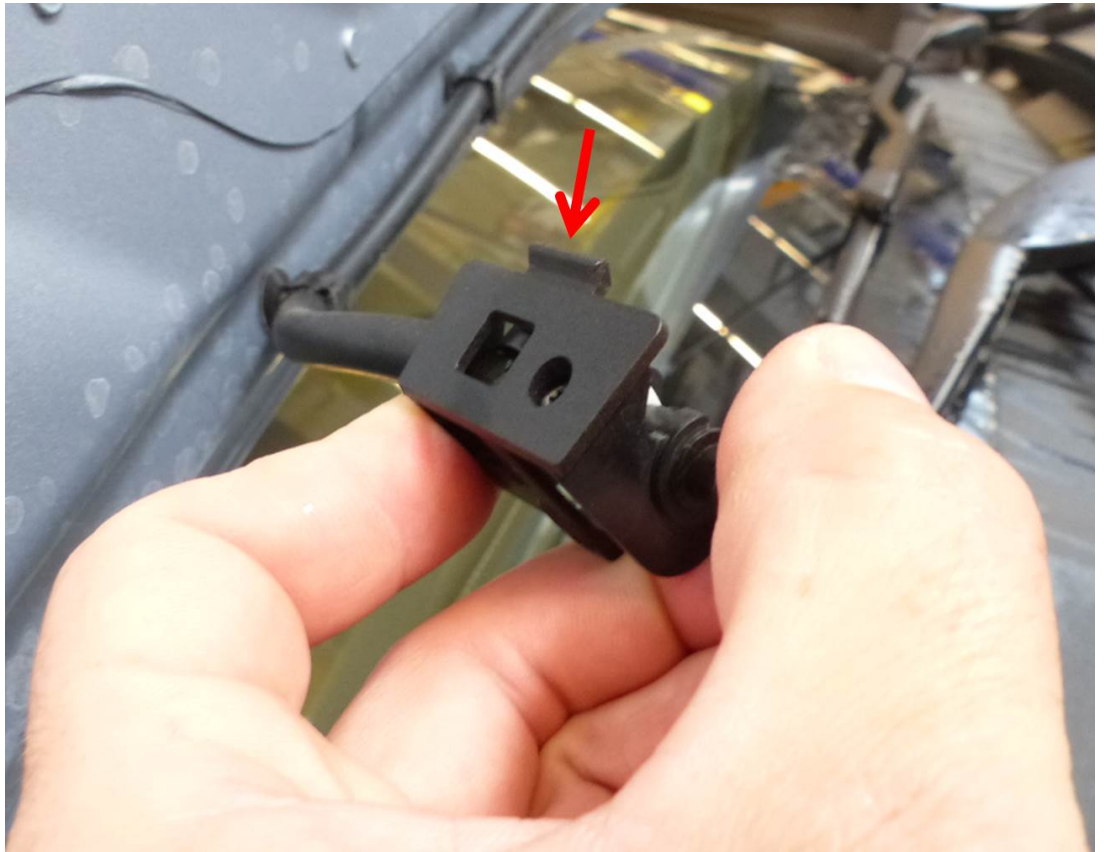


Bild3.jpg:

