 HYUNDAI Technical Service Bulletin	GROUP	NUMBER
	FUEL SYSTEM	19-FL-005H
	DATE	MODEL
AUGUST 2019		GENESIS (DH)
SUBJECT: GENESIS (DH) DTC P061B OR P0638		

Description: When servicing a Genesis (DH) with a “Check Engine light” and any of the following DTCs listed below are found stored, replace the throttle body.

- DTC P061B - Internal Control Module Torque Calculation Performance.
- DTC P0638 - Throttle Actuator Control Bank 1 - Range/Performance.


Applicable Vehicles: 2015-2016MY Genesis Sedan (DH) with 3.8L GDI engine.

WARRANTY INFORMATION:

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART
2015-16 Genesis Sedan (DH)	35100R00	BODY ASSY-THROTTLE AND/OR GASKET	Refer to WEBLTS for current LTS	35100-3CAC0

SERVICE PROCEDURE:

1. Replace the Throttle Body according to the shop manual repair procedure found at HyundaiTechInfo.com:

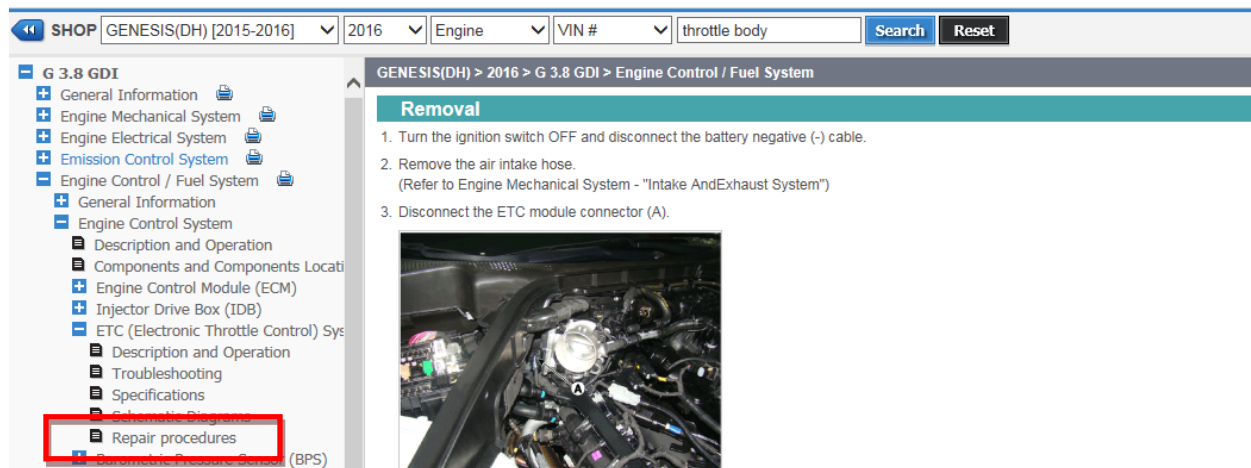

The screenshot shows the Hyundai TechInfo interface. At the top, there is a search bar with 'GENESIS(DH) [2015-2016]', '2016', 'Engine', 'VIN #', and 'throttle body' entered. Below the search bar, a navigation tree on the left shows the 'Repair procedures' option highlighted in red. The main content area displays the 'Removal' procedure for the throttle body, including three numbered steps and an image of the engine bay.

2. Erase the DTC by GDS in the Engine system and clear DTC in the Bluelink system.