



SERVICE BULLETIN

Classification:

EL16-013

Reference:

NTB16-034

Date:

March 31, 2016

2015 MURANO; BUZZ NOISE FROM SEAT WITH SEAT CLIMATE CONTROL HEATER TURNED ON

APPLIED VEHICLE: 2015 Murano (Z52)

IF YOU CONFIRM

A buzz noise coming from:

- The driver seat when the driver seat climate control heater is turned ON.
and/or
- The passenger seat when the passenger seat climate control heater is turned ON.

ACTION

Replace the climate controlled seat control unit.

A = Screws

B = Harness Connectors

- Replace the control unit only for the seat that is making the buzz noise.
- Refer to the Electronic Service Manual (ESM), section SE-Seat, for replacement information.

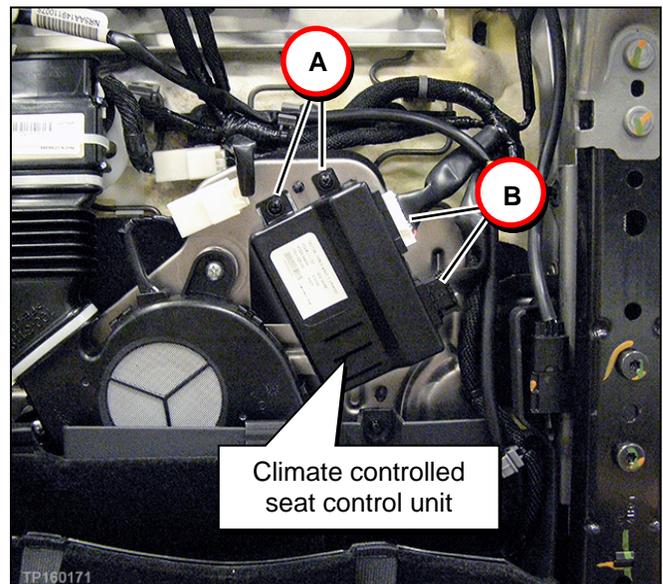


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
CONTROL BOX Climate Controlled Seat Control Unit (Driver Side or Passenger Side)	873D6-5AA6A	1



Figure 2

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace fan control unit – one side	873D6-5AA6A	VH11AA	ZE	32	(1)

(1) Refer to the Nissan Online Warranty Flat Rate Manual for the flat rate time.

NOTE: If both sides are needed, claim on separate repair lines.