



Volvo VN Models - Overhead Light Loose, Detaching From Headliner



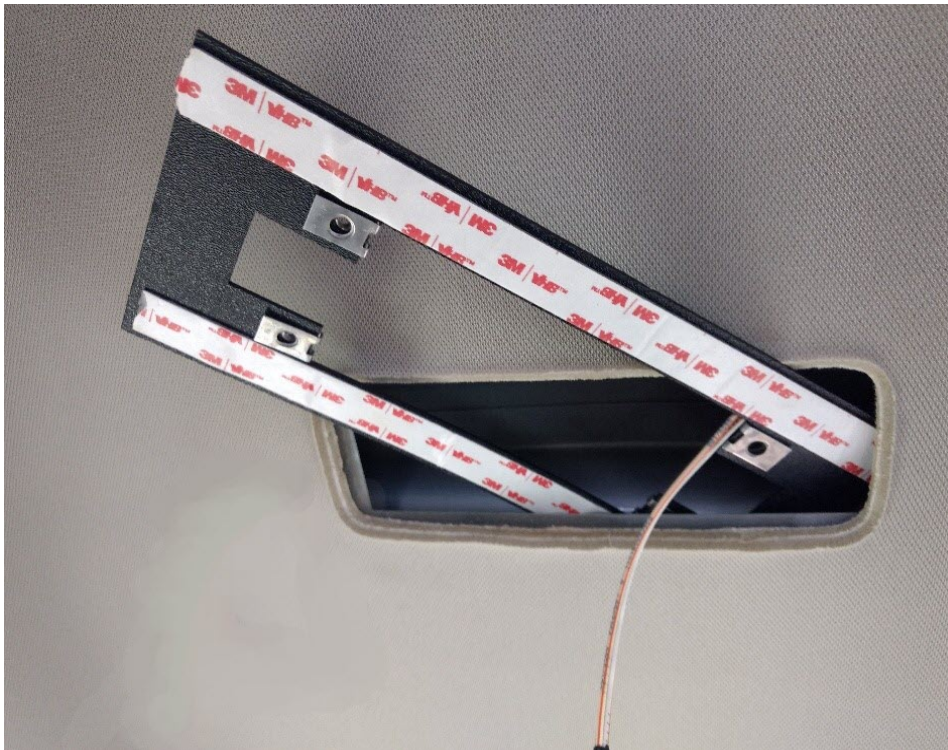
For Volvo VN models, the overhead light may become loose and possibly separate from the headliner. A repair kit has been developed that adds to the current light assembly and properly secures the light to the headliner. The kit can be applied without removal of the headliner.



Parts

Repair Kit Part Number - 24161301

Repair

1. Remove the light assembly from the headliner and disconnect it from its wire harness.
2. Route the wire harness through the center of the backing plate, then insert the plate through the opening in the headliner.



-  Remove the backing from the tape strips center the four screw holes
 Live UI backing plate in the headliner opening. Press the plate into place once centered.

4. Attach the bezel to the backing plate using the four screws provided.



5. Reattach the wiring harness to the light and snap the light into the bezel. The completed assembly should look like the example below.



Tags [volvo](#) [overhead light](#) [loose](#) [falling out](#)

 Live UI

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article