




## Mack Granite - Diagnostic Trouble Code (DTC) P208464

If a Granite chassis is experiencing code P208464:

1. Check the Aftertreatment Control Module (ACM) location. If the ACM is mounted as shown below, continue with this solution.

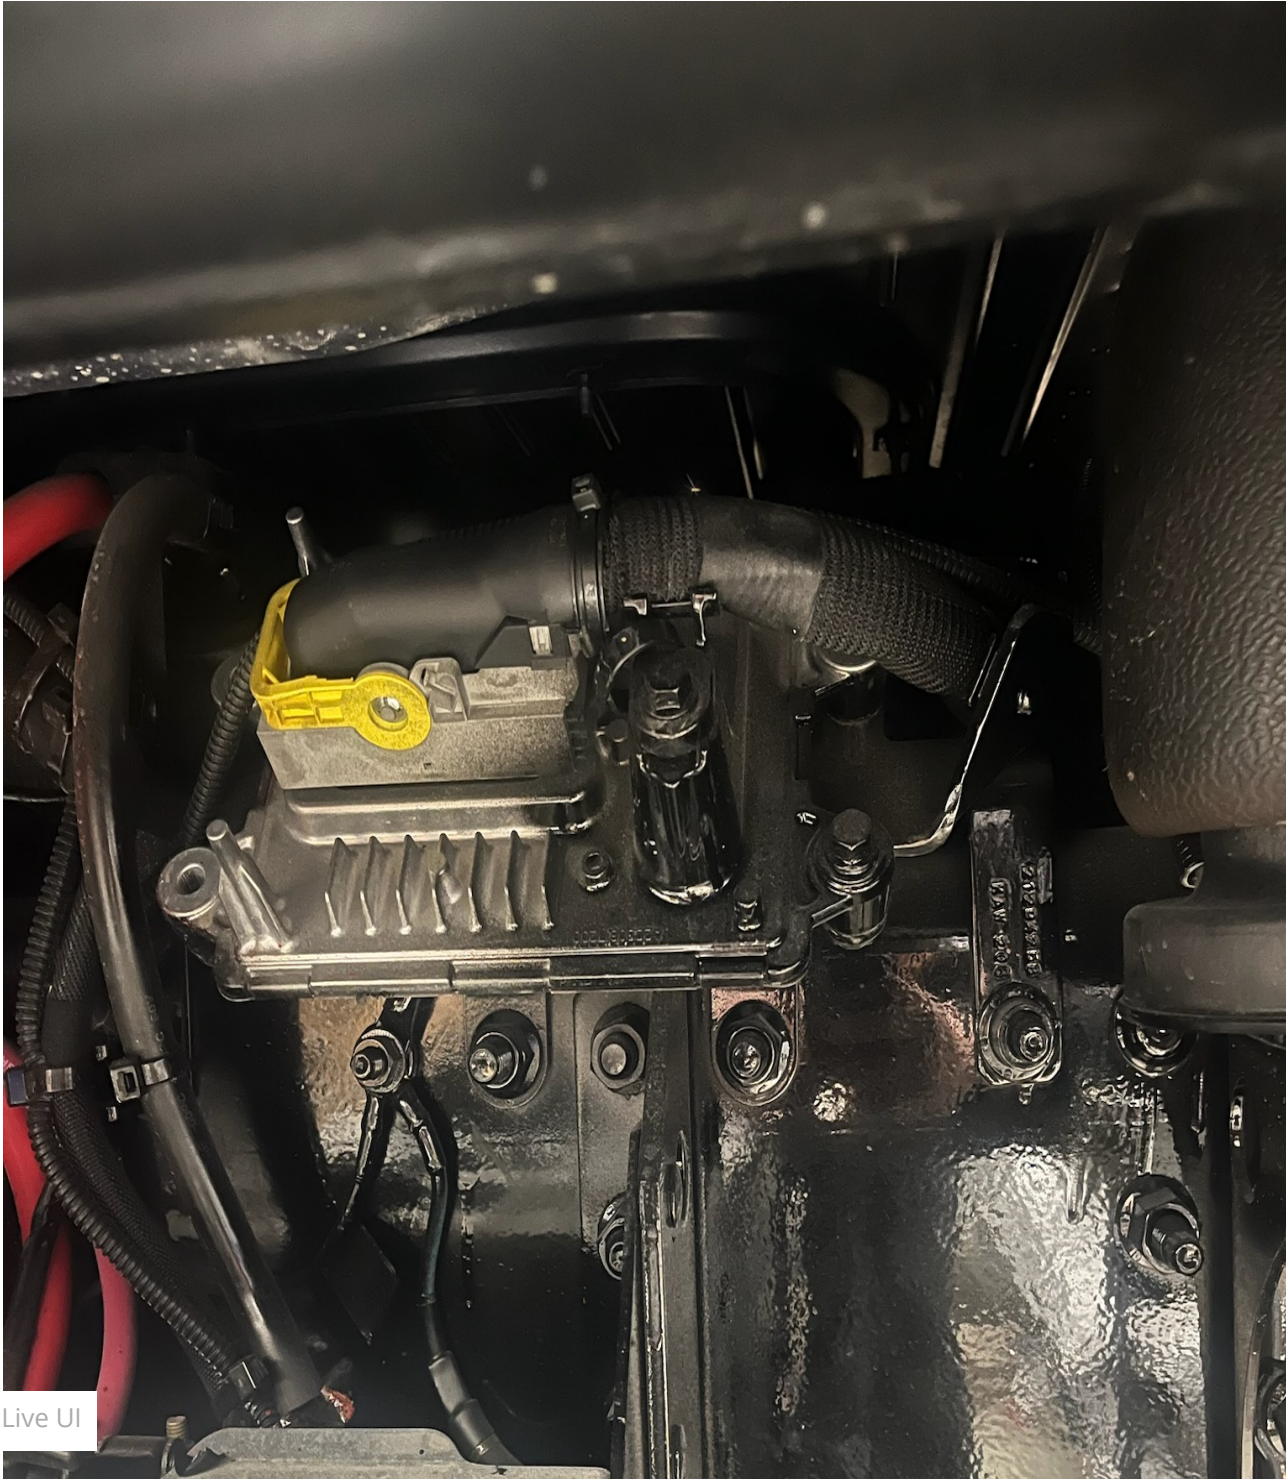

Live UI

2. Ensure there are no other temperature sensor codes present.
3. Disconnect the harness from the ACM.
4. Using the breakout box hooked **only to the ACM** as pictured below, measure resistance between pins 34 and 55.



Live UI  uate results:

- **If resistance is greater than 1.5k Ohms:** The issue is likely in the harness or sensor.
- **If resistance is less than 1.5k Ohms:** Replace the ACM. The module has experienced an internal failure.

 Tags [p208464](#) [mack](#)

Categories 

Vehicle System > Emissions

Vehicle System > Control Systems

Make and Model > Mack > GU/GR - Granite

### Related links and attachments

No links or attachments available

### Feedback

[Give feedback](#) to help improve the content of this article