

May 20, 2016

02412 Version 2

Center Console Lid Will Not Automatically Slide Close with Release Button

Supersedes 16-024, dated April 21, 2016, to revise the information highlighted in **yellow**.

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016	RLX	ALL	JH4KC1F...GC000001 thru JH4KC1F...GC000408
2016	RLX Sport Hybrid	ALL	JH4KC2F...GC000001 thru JH4KC2F...GC000005

REVISION SUMMARY

Under AFFECTED VEHICLES, VINs were added.

SYMPTOM

When you press the release button, the center console lid won't automatically close.

POSSIBLE CAUSE

There is too much friction in the mechanism to overcome the closure spring force.

CORRECTIVE ACTION

Replace the center console lid.

PARTS INFORMATION

Part Name	Part Number	Quantity
Center Console Lid (YR422L (Light Orchid), N-Off White)	83410-TY2-A04ZA	1
Center Console Lid (NH802L (Light Jewel Gray), B-Gray)	83410-TY2-A04ZB	1
Center Console Lid (NH690L (Premium Black), A-Black)	83410-TY2-A04ZC	1

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0421A2	Replace center console lid. (YR422L (Light Orchid), N-Off White)	0.3 hr	07403	03217	16-024N	83410-TY2-A02ZA
	16-024P				83410-TY2-A04ZB	
	16-024Q				83410-TY2-A04ZC	


Skill Level: Repair Technician

REPAIR PROCEDURE

1. Pull back on the damper arm to release it from the center console lid.



2. Press the upper lock release lever to release this end of the lid.

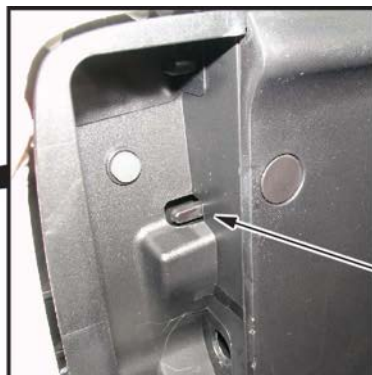

Press the upper lock release lever to release this end of the console.

3. Press the lock release button to release the lid, then remove it.

Press the lock release button to release this end of the console.



4. Install the new center console lid to the center console as shown, then press the lock release button and maneuver the lid until it clicks into the hole to secure it into place.

NEW CONSOLE ARMREST



Press the lock release button to secure this end of the console.



5. Press the lower lock release lever until it clicks into place.

NOTE: You may need to move the lid back and forth to get the pin to line up with the hole and click into place.



**LOCK
RELEASE
LEVER**

This rod will snap into place when the lock release lever is pressed.

Press the lower lock release lever to secure this end of the console.

6. Insert the damper rod to the console lid until it clicks into place.



7. Make sure the lid opens and slides normally.

END