
	KIN	GROUP SST NUMBER 033	MODEL Optima (QF/TF) Sorento (XM) Cadenza (VG) Soul (AM/PS) Sportage (SL) DATE April 2014		
	TECHNICAL SERVICE BULLETIN				
SUBJECT:	SJECT: SPECIAL SERVICE TOOL FOR HOOD RELEASE LEVER REMOVAL				

This bulletin provides information related to the introduction of a new Special Service Tool (SST) (A) developed to prevent the hood release lever pivot point (B) from being damaged when removing the hood release lever. Follow the instructions included in this bulletin to properly remove the hood release lever using the new SST.



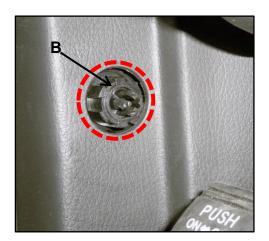

***** NOTICE

One SST will be shipped to every dealer free of charge. Additional tools can be ordered through Snap-on (see page 2). <u>Make sure this tool is available to technicians whenever removal of the hood release lever is required.</u>

File Under: Special Service Tool

Circulate To:	General Manager	Service Manager	X Parts Manager
X Service Adviso	rs 🛛 Technicians	🛛 Body Shop Manager	🛛 Fleet Repair

Page 2

SUBJECT:

SPECIAL SERVICE TOOL FOR HOOD RELEASE LEVER REMOVAL

SERVICE PROCEDURE:

1. Insert the SST into the hole on the hood release lever, as shown.



2. While applying slight inward pressure to the end of the SST, use a plastic prying tool to remove the hood release lever.



3. To reinstall, place the hood release lever on the pivot point and gently snap it in place.

REQUIRED SPECIAL TOOLS:

Tool Name	Part Number	Comments
Hood Release Lever Tool	07120-11000	Additional tools can be ordered through Snap-on Equipment Solutions at (888) 542-1011