Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2013 Mazda Motor of America, Inc.

Subject:

PASSENGER AIRBAG DEACTIVATION (PAD) INDICATOR LIGHT ILLUMINATION

Last Issued: 11/19/2013

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 08-002/12 issued 06/29/2012 and 08-003/11 issued 03/25/2011. The APPLICABLE MODEL(S)/VINS and PAD INDICATOR LIGHT OPERATION have been revised.
- · Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

I	2013- <mark>2014</mark> CX-5	2011- <mark>2014</mark> Mazda2	2012- <mark>2014</mark> Mazda5	2006- <mark>2014</mark> MX-5
I	2007- <mark>2012</mark> CX-7	2004- <mark>2014</mark> Mazda3	2004- <mark>2014</mark> Mazda6	2006-2011 RX-8
I	2007- <mark>2014</mark> CX-9	2006-2010 Mazda5	2004-2005 Miata	2004-2006 MPV

DESCRIPTION

This information is provided to help address Passenger Airbag Deactivation (PAD) Indicator illumination concerns during vehicle service.

TROUBLESHOOTING

- 1. Are both the Airbag Warning and the PAD indicator lights ON?
 - Yes This bulletin does not apply. Refer to MS3 online or Workshop Manual (section 08-02 DTC TABLE) for troubleshooting and repair.
 - No Proceed to step 2.



Airbag Warning



PAD Indicator*

^{*} PAD Indicator image will vary by model.

Bulletin No: 08-001/13	Last Issued: 11/19/2013
© 2013 Mazda Motor of America, Inc.	

- 2. Is the Airbag Warning light OFF and the PAD indicator light ON solid or ON and OFF intermittently with the front passenger seat occupied?
 - Yes Proceed to "PAD INDICATOR LIGHT OPERATION".
 - No This bulletin does not apply. Refer to MS3 online or Workshop Manual (section 08-03 SYMPTOM TROUBLESHOOTING) for troubleshooting and repair.

PAD INDICATOR LIGHT OPERATION

PAD indicator light is ON or OFF under the following conditions:



Condition detected by the PAD system	PAD indicator light	Front passenger and side air bags	Front passenger seat belt pretensioner system	Curtain air bag system
Empty (Not occupied)*	OFF ON (2013-14 CX-5, 2014 Mazda3 and 2014 Mazda6****)	Deactivated	Deactivated	Ready
Child or child- restraint system**	ON	Deactivated	Deactivated	Ready
Adult***	OFF	Ready	Ready	Ready

^{*} If the front passenger seat belt is buckled, the front PAD indicator light illuminates, this is not a malfunction.

^{**}If a larger child sits on the front passenger seat, the sensors might detect the child as being an adult depending on the child's physical proportions.

^{***}If a smaller adult sits on the front passenger seat, the sensors might detect the person as being a child depending on the person's physical proportions.

^{****2013-14} CX-5, 2014 Mazda3 and 2014 Mazda6: The PAD indicator light will remain ON when the front passenger seat is empty (not occupied).

Bulletin No: 08-001/13	Last Issued: 11/19/2013
© 2013 Mazda Motor of America, Inc.	

PAD SYSTEM

PAD indicator illuminates to inform the customer that the passenger airbag system (passenger airbag, passenger side airbag, and passenger seat belt pre-tensioner) is deactivated.

Passenger airbag system is deactivated to help reduce the potential injuries or fatalities to smaller occupants or children due to air-bag inflation.


Front seat weight sensors measure just the weight that is actually applied on the seat cushion. The value detected by the sensors and the actual passenger weight may not always be equal.


The detected value may be less than the actual passenger's weight.


Example, the passenger is:


- leaning on the door (A).
- holding the assist grip (B).
- leaning on the center console arm rest (C).
- slouching (D).

WARNING: If items are placed on the passenger's lap, the detected value may be more.

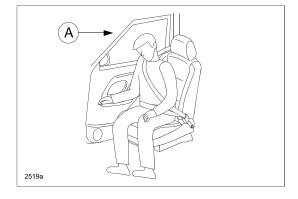

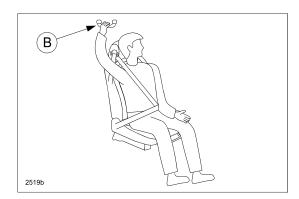

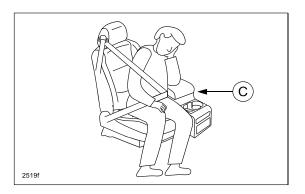


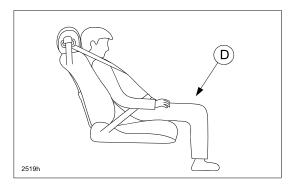

In the examples above, the PAD indicator illuminates when the value detected by the sensors becomes less than the weight threshold. Also, a front seat passenger who weighs near the airbag's cutoff threshold can cause the PAD indicator illumination to turn on and off intermittently.

Bulletin No: 08-001/13	Last Issued: 11/19/2013
© 2013 Mazda Motor of America, Inc.	

Always sit with an appropriate seat posture by fitting your back to the seat back and make sure to wear a seatbelt.

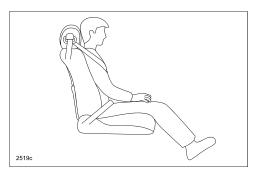

FREQUENTLY ASKED QUESTIONS (Q&A)

Q 1	Is it still safe and secure to sit in passenger seat with PAD indicator illuminated?		
A 1	It is required by regulation to deactivate the passenger airbag system for smaller occupant sitting in the passenger seat who may be at greater risk of injury from a deploying air bag.		
Q 2	Why does the PAD indicator turn on and off intermittently?		
A 2	Passenger's seating posture can affect the PAD system's ON or OFF decision. Especially for passengers who weigh near the threshold they are likely to experience this symptom, as the measurement of the occupancy sensors vary around the threshold.		
Q 3	Why does the PAD indicator keep illuminating even with an appropriate seating posture?		
A 3	Passenger's weight is not heavy enough to activate the passenger airbag system even though the passenger sits in the seat with an appropriate seating posture.		
Q 4	Why does the PAD indicator illuminate on my new Mazda? I've never had this occur on previous Mazdas?		
A 4	Due to the change of regulation, the threshold to turn the system on or off has changed.		
	Also, due to the difference in seat design, weight distribution on the seat may change. As as a result, the PAD indicator may illuminate on current Mazda vehicle even though the same customer did not experienced the PAD indicator illumination on previous Mazda vehicle.		

See the Owner's Manual (section 2) for additional information.