



Volvo Models

Volvo Model VNR , VNX , VNL , VNM , VHD , VAH

Engine family

Engine family 11L Engine , 13L Engine , 16L Engine

Emission Standard

Emission Standard 2018 , OBD2017 , US17 , US16 , US15 , US13 OBD , US14


**** SOLUTION ****

Title *Expired - Volvo Chassis - Diagnostic Trouble Code (DTC) P026C Lighting The Malfunction Indicator Light (MIL) - US14+OBD13, US14+OBD15 And US14+OBD16 - Commonly Model Years 2015 To 2017 (Non-Common Rail Fuel System) Chassis*

Cause US14+OBD13, US14+OBD15 And US14+OBD16 (Commonly Model Years 2015 To 2017) chassis may log DTC P026C.

Solution **Verify the chassis emissions level**

- Details can be found in the Product Details box on the Product tab in PTT as seen below:

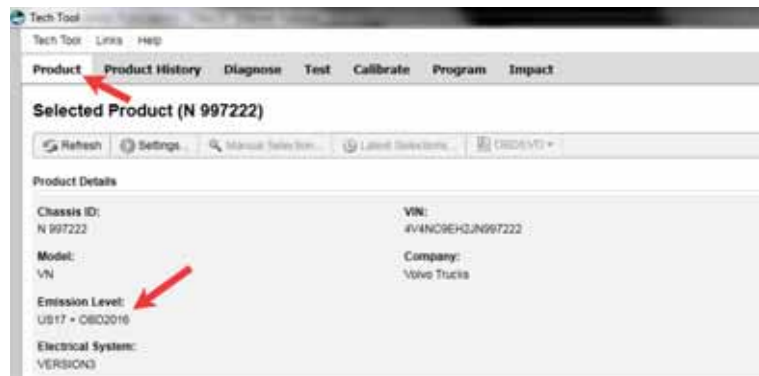

For US14+OBD13

- Refer to [FSB 284-066 Engine Control Module \(ECM\) and Aftertreatment Control Module \(ACM\). Reprogramming.](#)
- This bulletin is current as of 17 April 2018.

For US14+OBD15

- Software improvements have been released to address this code. Refer to the table

below:


ECM	Main Software	Action Required
D11/ D13	Equal or Less Than 22741776	Update to Latest Software
D16	Equal or Less Than 22644015	Update to Latest Software

For US14+OBD16

- Refer to [FSB 284-065 Engine Control Module \(ECM\) and Aftertreatment Control Module \(ACM\). Reprogramming.](#)

- This bulletin is current as of 17 April 2018.

If any other symptoms or related codes are present, normal diagnostics will need to be performed for them. P026C generating due to software will not cause physical symptoms.

Campaign code	FSB 284-065; FSB 284-066
Solution visibility	Dealer distribution
Function(s)/component(s) affected	
Function affected	FSB , fuel supply , injectors , exhaust , 1 1 0 EMS , 2 1 0 ACM
Function Group	
Function Group	254 catalytic converter; exhaust emission control equipment , 255 turbocharger , 258 emissions after-treatment , 284 control system, fuel supply
Customer effect	
Main customer effect	regeneration , calibration/programming/pairing/missing operation , diagnostics /methodology , efficiency/abnormal behavior , fault code/display
Lights/Messages on information display	 Driver's information warning pictogram
Fault code(s)	
OBD 2013 Diagnostic Trouble Codes	P026C00
Conditions	
Vehicle operating mode	when driving , when stationary
Frequency of occurrence of problem	always
External temperature	20 / 30 °C
Administration	
Author	RU4469V
Dealer ID	RU4469V
Last modified by	RU4469V

Creation date 07-02-2018 21:02

Date of last update 14-09-2018 14:09

Status *Expired*

Average score 5

Number of scores 1