


Latest Vehicle Concern Fixes



Check Engine Lamp with P24C6-00 stored	17/18MY F-PACE equipped with AJ20D
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">• Check Engine Lamp illuminated <p><u>Technical Description:</u></p> <ul style="list-style-type: none">• P24C6-00 for Particulate Matter Temperature sensor circuit stored in the PCM <p><u>Status:</u></p> <ul style="list-style-type: none">• Under Investigation• I've received a number of warranty claims for this particular code. This code describes a circuit issue with the temperature sensor, but is actually an error with the PM Sensor circuit not a temperature sensor (refer to OBD documentation in TOPIx for support).• Diagnose any circuit concerns. If no trouble is found and a PM Sensor is replaced for this DTC, please raise an EPQR. I'd like to move forward with an investigation into replacement of these sensors but I need additional reports to do so.	 A technical wiring diagram of the particulate matter (PM) sensor circuit. The diagram shows various electrical components, including a sensor unit and a control module, connected by wires. A red circle highlights a specific section of the wiring, likely indicating the area of concern for the P24C6-00 fault code.

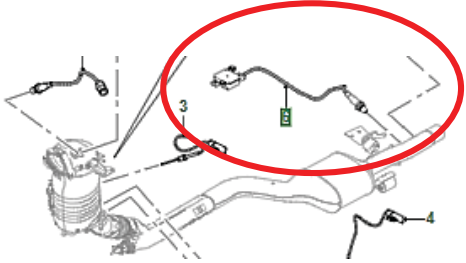