

[Translate](#)



PA&A 2022-12 Trailer Hitch Installation on MY22 Can-Am Spyder - Rear Wheel Axle Replacement Needed

Product: **PA&A**
 Bulletin type: **Quality**
 Bulletin no: **2022-12** (rbg2022-012 en LG)
 Revision no:
 Revision date:
 Campaign no.:
 Publication date: **June 9, 2022**
 Subject: **Trailer Hitch Installation on MY22 Can-Am Spyder - Rear Wheel Axle Replacement Needed**


IMPORTANT
All involved customers must be notified

MODEL YEAR	Vehicle	Article	KIT Part number
2022	All Spyder RT (to be equipped with an Accessory Trailer Hitch)	Trailer Hitch Kit	219400990
	Spyder F3-T Spyder F3 Limited (to be equipped with an Accessory Trailer Hitch)		219401094

PROBLEM

When trying to install a trailer hitch kit, the internal diameter of the stock rear axle is too small to install the trailer hitch axle.


Vehicle	trailer hitch part number
RT	219400990
F3-T F3 Limited	219401094

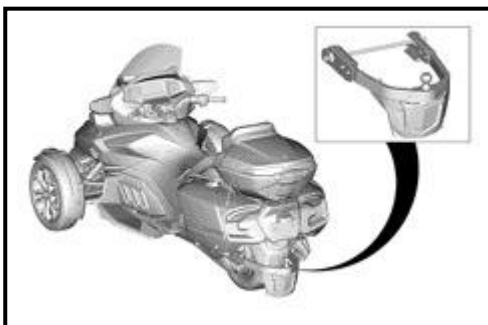

SOLUTION

[Translate](#)

Replace the rear wheel axle and nut.

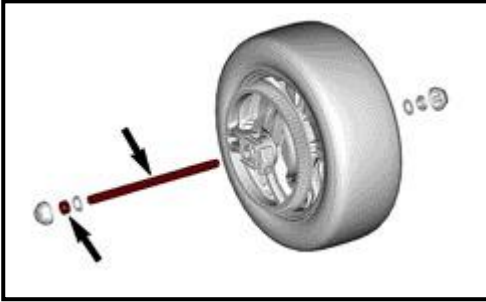

REQUIRED PARTS

Order parts through regular channel.

Description	part number	QTY
Rear wheel axle	705501691	1
Axle nut	250100170	1

NOTE: The rear wheel axle will be available for order by mid-June.

CORRECTIVE ACTION

Refer to *REMOVING THE REAR WHEEL* in *DRIVE BELT AND REAR WHEEL* subsection of the appropriate *ONLINESERVICE MANUAL*.

NOTE: Do not remove the rear wheel completely.

WARRANTY

Submit a warranty claim using the following information.

In BOSSWeb, under the WARRANTY tab, select PARTS CLAIM.

Claim details	OVER THE COUNTER	DEALER INSTALLED
Repair Order Number	Enter repair order number	Enter repair order number
Product Line	Roadster	Roadster
Authorization Number	-	-
Part Type	Over the counter	Dealer installed
Serial Number	Enter unit's serial number	Enter unit's serial number
Purchase Date	Purchase date of kit	Purchase date of kit
Accessory Failure Date	Appropriate date	Appropriate date
Repair Completion Date	Appropriate date	Appropriate date
Nature of Defect	MY22 Can-Am Spyder Trailer Hitch 2022-12	MY22 Can-Am Spyder Trailer Hitch 2022-12
Trouble Part Number	219400990 - Spyder RT 219401094 - Spyder F3	219400990 - Spyder RT 219401094 - Spyder F3
System Code	61	61

Claim details	OVER THE COUNTER	DEALER INS*	Translate
Job Number The job number only becomes available when DEALER INSTALLED is selected)	-	00 - no labour involved	
Trouble Code	AC6	AC6	
Part Required for Repair	705501691 (Rear wheel axle) 250100170 (Axle nut)	705501691 (Rear wheel axle) 250100170 (Axle nut)	
Labor Only	Part number : Use same part number as <i>PART REQUIRED FOR REPAIR</i>	Part number : Use same part number as <i>PART REQUIRED FOR REPAIR</i> . Hours : 0.8	
Expiration Date	2024-10-31	2024-10-31	
- = Leave empty / not available			

[PRINTABLE PDF VERSION.pdf](#)