

# **Technical Service Bulletin**

SB-10056757-1673

SUBJECT:			No:	TSB-14-37-005
DOINTS CEDVICE MANUAL DEVICION			DATE:	August, 2014
			MODE	L: 2007-13 Outlander
CIRCULATE TO:	[ ] GENERAL MANAGER	[X] PARTS MANAGER		[X]TECHNICIAN
[X] SERVICE ADVISOR	[ X ] SERVICE MANAGER	I 1WARRANTY PROCESS	OR	[ 1SALES MANAGER

#### **PURPOSE**

This TSB updates the removal service point in the service manual with new information about power steering hoses.

This TSB contains new or changed information only.


### **AFFECTED VEHICLES**

2007-2013 Outlander V6 equipped with F6AJA or W6AJA transaxle

#### AFFECTED SERVICE MANUALS


- 2007 Outlander Service Manual, Group 37 Power Steering —> Power Steering Hoses —> <3.0L Engine> Removal and Installation
  - Removal and Installation —> Removal Service Points >>A<< Heat Protector/Pressure Hose —> Assembly/Return Tube Assembly/Return Tube Removal
- 2008 2013 Outlander Service Manual, Group 37A Power Steering —> Power Steering Hoses —> <3.0L Engine> Removal and Installation
  - Removal and Installation —> Removal Service Points >>A<< Heat Protector/Pressure Hose —> Assembly/Return Tube Assembly/Return Tube Removal

Please replace the instruction for the 2007–2013 Outlander Service Manual, Group 37 – Power Steering —> Power Steering Hoses —> Removal and Installation <3.0L Engine> with the following illustration:

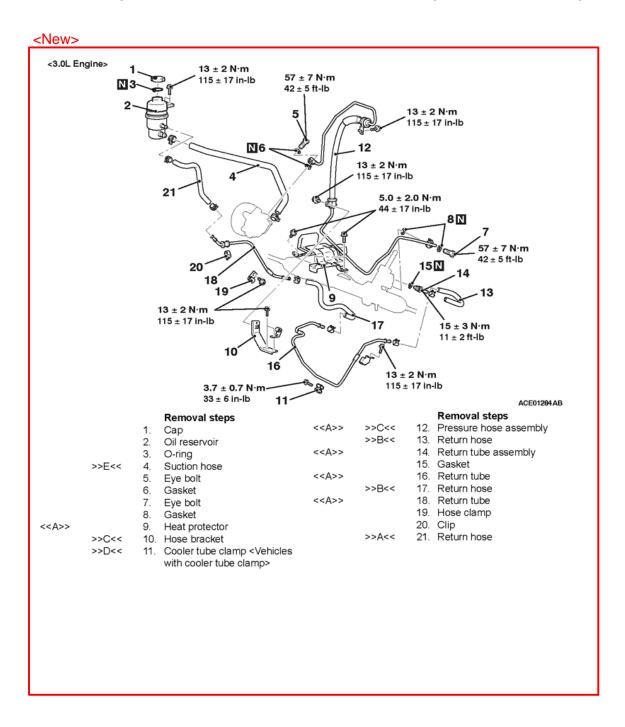

Please make the following additions and changes to the 2007–2013 Outlander Service Manual, Group 37 – Power Steering —> Power Steering Hoses —> Removal and Installation —> Removal Service Points -> >A<< Heat Protector/Pressure Hose Assembly/Return Tube Assembly/Return Tube Removal

#### <Added>

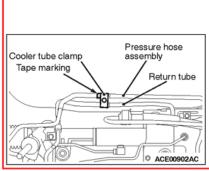


## >>D<< COOLER TUBE CLAMP INSTALLATION <VEHICLES WITH COOLER TUBE CLAMP>

The end of the tape marking on the pressure hose assembly must abut on the end of the cooler tube clamp.

#### <Changed> E



 Align the oil reservoir side suction hose marking within the area shown in the figure and connect the suction hose.

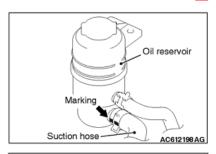

C2.4L Engine 30°

Oil pump

Marking

Suction hose

AC607830 AF

