

Subject

GX460 Front Seatback Cover Service

Market

USA

Service Category

Vehicle Interior

Section

Seat

Applicability

2010-2014 GX460

APPLICABLE VEHICLES

2010-2014

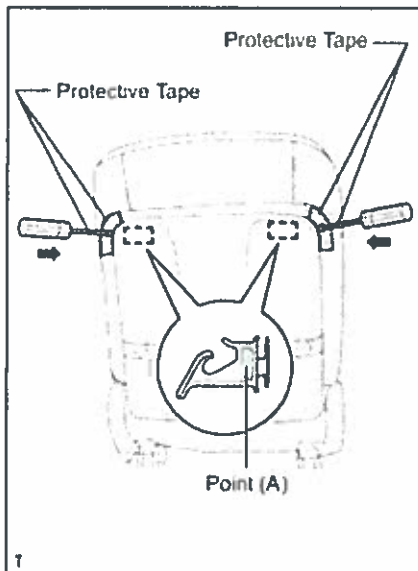
GX460

CONDITION

The front seatback cover may have a loose fit due to damage of the retention clips following removal of the seatback for service.

RECOMMENDATIONS

Please use caution when removing/installing the seatback cover for service. Utilizing the Repair Manual procedure will ensure that there is minimum chance for damage during service.

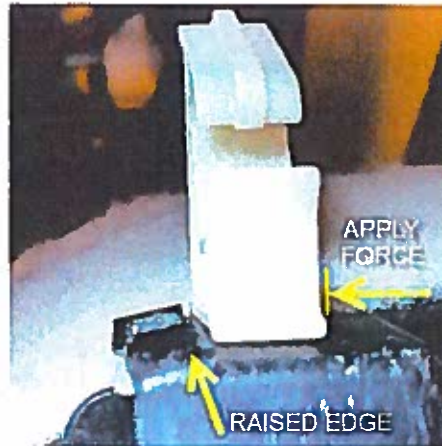
REMOVAL

Use a screwdriver to apply force to clips at point A one side at a time.



Point A from the RM highlighted

Driver Side Seatback cover with the clip engaged. View is from the center of the vehicle looking towards the door.

Subject
GX460 Front Seatback Cover Service**Market**
USA**Applicability**
2010-2014 GX460**RECOMMENDATIONS**

1. Apply force at point A towards the center of the seatback cover to dismount the clip.
2. The clip must overcome the raised edge on the seatback cover that is used keep the clip in place.



View of the clip once it has been
successfully detached from the seatback cover

Subject:

GX460 Front Seatback Cover Service

Market:

USA

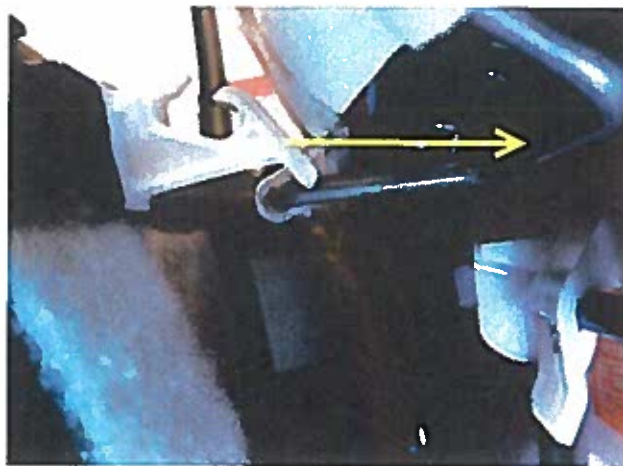
Applicability:

2010-2014 GX460

RECOMMENDATIONS**INSTALLATION**

There is potential for the clip to become damaged during the installation of the seatback cover

Use caution when reinstalling the seat back cover to ensure that the clip is not damaged.

**LINK REFERENCES**

1. [SEAT: FRONT SEAT ASSEMBLY: DISASSEMBLY; 2012 MY GX460 \[08/2011 - ???????\]](#)

