

GROUP	NUMBER
Body Electrical	19-BE-004H
DATE	MODEL(S)
March, 2019	VARIOUS


SUBJECT: OUTSIDE MIRROR ASSEMBLY SERVICEABLE PARTS

This TSB supersedes 18-BE-017-2 to modify the Parts Information section and to also include Equus model.

Description: This bulletin provides information on the serviceable parts for the outside mirror assembly. When diagnosing and repairing the outside mirror, do not replace the entire assembly. Refer to page 2 of this TSB for replacement of individual parts.

Applicable Vehicles: Multiple Models – See table on Page 2.

Parts Information:

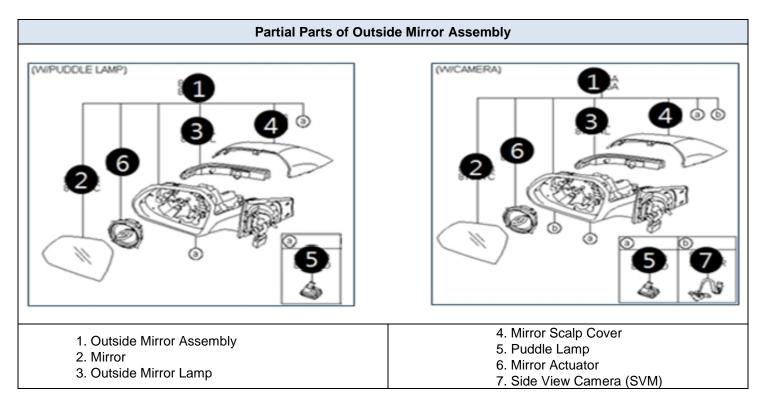

SUBJECT:

OUTSIDE MIRROR ASSEMBLY SERVICEABLE PARTS

Model (Model Year)	Mirror	Mirror Actuator	Scalp Cover*	Outside Mirror Lamp	Puddle Lamp	SVM Camera
Accent (2012 – 2017)	•	·	X	•	NO OPTION	NO OPTION
Azera (2012 – 2017)	•	•	x	х	x	х
Elantra – 5NP (2017 -)	•	x	•	Х	NO OPTION	NO OPTION
Elantra - KMH (2017 -)	•	•	•	Х	NO OPTION	NO OPTION
Elantra GT (2018 -)	•	•	X	•	NO OPTION	NO OPTION
Equus (2010 – 2013)	•	X	x	•	•	NO OPTION
Equus (2014 – 2016)	•	X	x	•	•	•
Genesis Coupe (2010 – 2016)	•	•	X	X	NO OPTION	NO OPTION
Genesis (2015 – 2016)	•	•	X	X	•	•
loniq (2017-)	•	•	•	•	NO OPTION	NO OPTION
Kona (2018 -)	•	•	X	X	NO OPTION	NO OPTION
Santa Fe (2013 – 2018)	•	X	•	•	x	x
Santa Fe Sport (2013 – 2018)	•	X	•	•	X	x
Santa Fe (2019 -)	•	X	•	•	X	x
Sonata (2015 – 2018)	•	•	X	•	NO OPTION	NO OPTION
Sonata Hybrid (2015 – 2018)	•	•	•	•	NO OPTION	NO OPTION
Tucson (2016 – 2018)	•	•	•	•	•	х
Veloster (2012 – 2017)	•	•	X	•	NO OPTION	NO OPTION
Veloster (2019 -)	•	•	x	Х	NO OPTION	NO OPTION
Veracruz (2007 – 2012)	•	X	X	•	•	NO OPTION

NOTICE

- ("•": Replaceable part, "X": Non-replaceable part)
- *If clips and hooks of scalp cover are damaged or broken, replace the scalp cover with a new one.

Warranty Information:

• Normal warranty applies; refer to the WebDCS Labor Time Standards section to determine OP Code and Time.

SERVICE PROCDURE FOR PARTIAL PARTS OF OUTSIDE MIRROR ASSEMBLY:

• Refer to the applicable service shop manual in the "Body Electrical System" section for repairs.