



SERVICE BULLETIN

Classification: EL12-034	Reference: NTB12-043	Date: May 4, 2012
-----------------------------	-------------------------	----------------------

2008 – 2012 ROGUE ENGINE HARNESS REPLACEMENT

APPLIED VEHICLES: 2008 – 2012 Rogue (S35)

SERVICE INFORMATION

If for any reason the engine harness is replaced, during the replacement of the harness, install a rubber protective pad on the battery tray support bracket at the location shown in Figure 1 below. Refer to the Service Procedure for installation instructions.

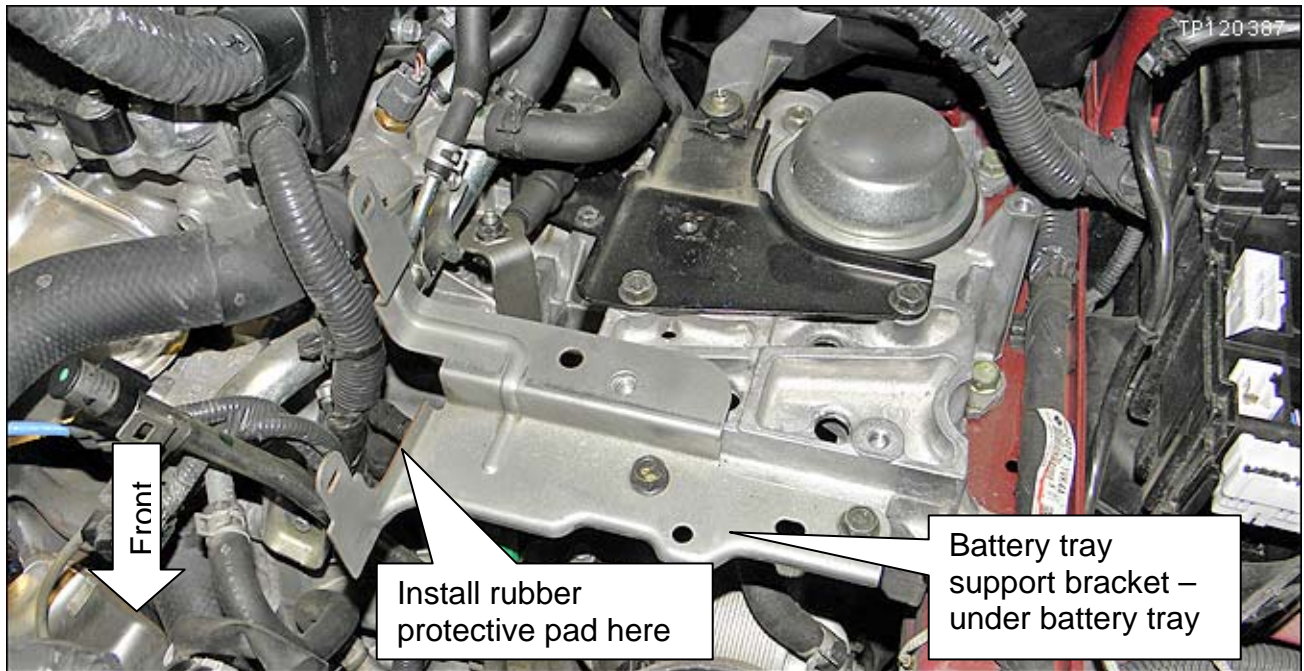


Figure 1

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Rubber Protective Pad	76884-CA00A	1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Cut the rubber protective pad in half, length wise.
 - Only $\frac{1}{2}$ (either half) of the pad will be used.



Figure 2

2. Clean the area where the protective pad will be installed.
 - Installation area is shown with dashed line.
 - Clean both sides of the bracket edge. Pad will be folded over and attached to both sides.

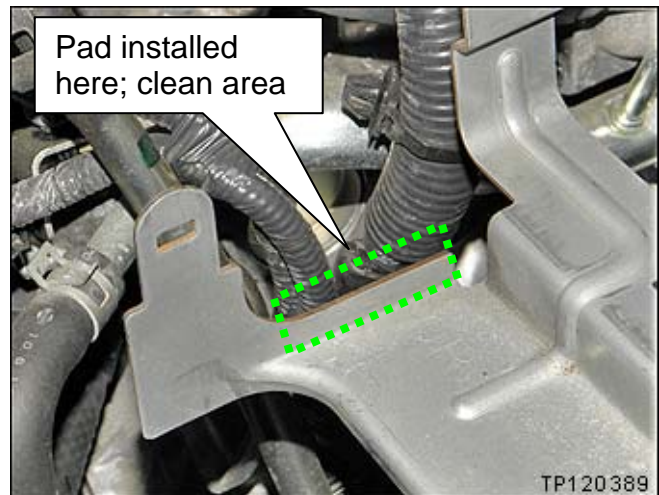


Figure 2

3. Attach the rubber protective pad as shown.
4. Fold the protective pad over the bracket edge so it covers and sticks to both side.

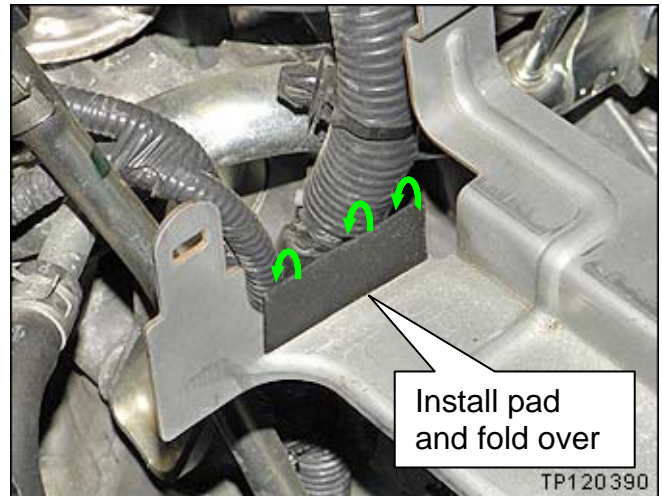


Figure 3

NOTE: Figure 4 shows the finished installation of the protective pad on both sides of the bracket.



Figure 4