NISSAN NORTH AMERICA, INC.

Technical Bulletin



SERVICE BULLETIN

Classification: Reference: Date:

EL12-034a NTB12-043a May 18, 2012

2008 – 2012 ROGUE ENGINE HARNESS REPLACEMENT

This bulletin has been amended. Applied VIN and Applied Date have been added.

Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2008 – 2012 Rogue (S35)

APPLIED VIN: Built on or before JN8AS5M(*)(*)CW 713595

APPLIED DATE: Built on or before March 28, 2012

SERVICE INFORMATION

If for any reason the engine harness is replaced, during the replacement of the harness, install a rubber protective pad on the battery tray support bracket at the location shown in Figure 1 below. Refer to the Service Procedure for installation instructions.

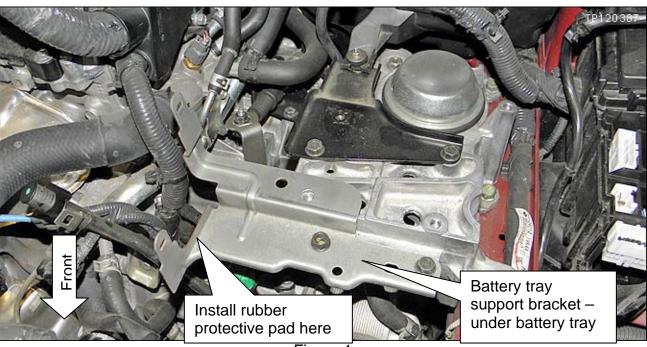


Figure 1

PARTS INFORMATION

DESCRIPTION	PART#	QUANTITY
Rubber Protective Pad	76884-CA00A	1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

- 1. Cut the rubber protective pad in half, length wise.
 - Only ½ (either half) of the pad will be used.

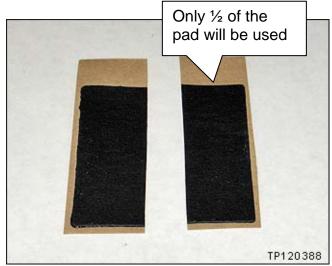


Figure 2

- 2. Clean the area where the protective pad will be installed.
 - Installation area is shown with dashed line.
 - Clean both sides of the bracket edge. Pad will be folded over and attached to both sides.

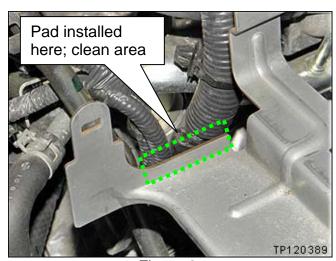


Figure 2

2/3 NTB12-043a

- 3. Attach the rubber protective pad as shown.
- 4. Fold the protective pad over the bracket edge so it covers and sticks to both side.

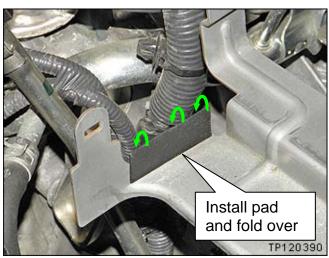


Figure 3

NOTE: Figure 4 shows the finished installation of the protective pad on both sides of the bracket.



Figure 4

3/3 NTB12-043a